


Land Office Santa Fe
Lease No. 07360
Unit Block

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

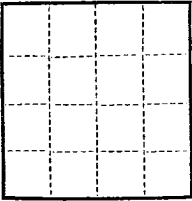

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	<u>Water Fracture</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 13, 1956


Well No. 63 is located 170 ft. from N line and 850 ft. from W line of sec. 23
N Section 23 27N T RPM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Sec. Blaney P.C. El Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6629 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

9-11-56 Total Depth 3200'. C.O.P.D. 3174'.
Water fractured Pictured Cliffs perforated intervals 3100-3140 with 39,600
gallons water and 40,000 sand. Breakdown pressure 2250 psi, maximum pressure
2700 psi, average treating pressure 1800 psi. Injection rate 55.9 bbls./min. Flush
1200 gallons. Natural gas none.

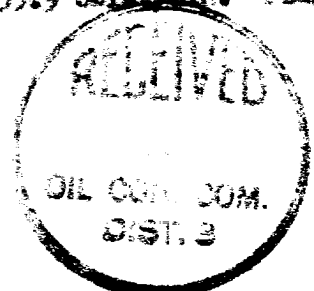

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company
Address Box 997
Farmington, New Mexico
By Carl H. Walsh
Title Petroleum Engineer