

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 079382
San Juan 27-5
Unit 18-01-001-001

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Well No. 37 is located 300 ft. from [N] line and 30 ft. from [E] line of sec. 20

NE 1/4 of Sec. 20 (1/4 Sec. and Sec. No.) 27N (Twp.) 24 (Range) R10W (Meridian)
Blanco Mesa Verde and (Field) Rio Arriba (County or Subdivision) N. Mexico (State or Territory)
undesignated Pictured Cliffs


The elevation of the derrick floor above sea level is 6491 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

3-6-58 Total Depth 5621'.
Run 54 joints 5 1/2", 15.90#, J-55 Liner (2199') set from 3412-
5617' with 125 sacks regular cement, 125 sacks Fomix.
followed by 50 sacks regular cement.
Hold 1000# for 30 minutes.

Top of cement by temperature survey at 3418'.

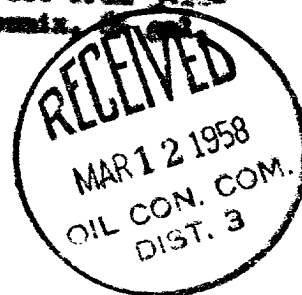

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 977
Farmington, New Mexico

Original Signed D. C. Johnson
By Petroleum Engineer
Title