

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE\*  
(Other instructions on re-  
verse side)

Form approved.  
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	7. UNIT AGREEMENT NAME San Juan 27-5 Unit
2. NAME OF OPERATOR El Paso Natural Gas Company	8. FARM OR LEASE NAME San Juan 27-5 Unit
3. ADDRESS OF OPERATOR PO Box 990, Farmington, NM 87401	9. WELL NO. 31 (PM)
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 990'N, 990'E e	10. FIELD AND POOL, OR WILDCAT Blanco Mesa Verde Tapacito Pictured Cliffs
14. PERMIT NO.	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 24, T-27-N, R-5-W NMPM
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6578'GL	12. COUNTY OR PARISH Rio Arriba
	13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input checked="" type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)


17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Pulled 1 1/4" Pictured Cliffs tubing and 2 3/8" Mesa Verde tubing with Baker seal units.

Dropped 2200' of tubing on Model "D" packer. Milled out packer and recovered 1065' of tubing.

on 4-8-72 Set a Baker Model "D" packer at 3535'. Ran 151 joints 2 3/8", 4.7#, J-55 Mesa Verde tubing, 4706.43' landed at 4716.43', ran 116 joints 1 1/4", 2.4#, J-55 Pictured Cliffs tubing, 3476.93' landed at 3486.93'.

Note: There is a 1135', 2 3/8" tubing fish in the bottom of this well.

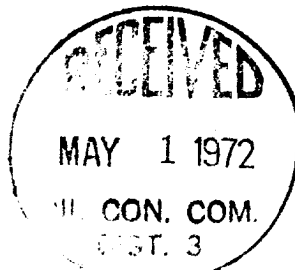

RECEIVED

APR 28 1972

U. S. GEOLOGICAL SURVEY  
DURANGO, COLO.

18. I hereby certify that the foregoing is true and correct

SIGNED Original Signed F. H. V'OOD

TITLE Petroleum Engineer

DATE April 26, 1972

(This space for Federal or State office use)

APPROVED BY  
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

\*See Instructions on Reverse Side