

Santa Fe

Land Office _____


Lease No. _____

Unit _____

San Juan 23-7 Unit

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

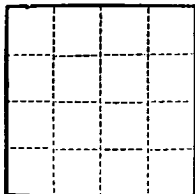

SUNDRY NOTICES AND REPORTS ON WELLS

RECEIVED

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 31, 1961

Well No. 122 is located 790 ft. from N line and 1850 ft. from W line of sec. 13
S.W. Section 13 27-S 7-W N.M.P.M.
(34 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
So. Blanco P. C. Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6550 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 7-25-61 total depth 2992'. C.O.T.D. 2767'.
Water fractured Pictured Cliffs perforated intervals
2905-11; 2914-20; 2922-28; with 27,384 gallons water
and 25,000# sand. Breakdown pressure 2900#, maximum
pressure 3600#, avg tr pr 3400#. Injection rate 19.3 BPM.
Flush 1000 gallons. 2 drops of 24 balls.



I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company
Address Box 990
Farmington, New Mexico
By Original Signed D. W. Meehan
Title Petroleum Engineer