

1000 Rio Brazos Rd. Aztec, NM 87410

Energy, Minerals and Natural Resources Department

Santa Fe, New Mexico 87504-2088

SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE
(Revised 3/9/94)

PIT REMEDIATION AND CLOSURE REPORT

Telephone: 505-324-5846

Address: 3315 Bloomfield Hwy - Farmington, NM 87401

Facility Or: San Juan 28-7 #109

Well Name

Location:	Unit or Qtr/Otr Sec	N	Sec	18 T	27N R	7W County	Rio Arriba
-----------	---------------------	---	-----	------	-------	-----------	------------

Pit Type: Separator Dehydrator _____ Other TDP

Land Type: BLM X State _____ Fee _____ Other

Pit Location: _____ Pit dimension: length 6' width 6' depth 4' _____
(Attach diagram)

Reference: wellhead X other

Footage from reference: 80'

Direction from reference:

<u> </u>	Degrees	<u> </u>		East	of	<u>X</u>	North
		X		West			South

Depth To Ground Water:

(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet	(20 points)
50 feet to 99 feet	(10 points)
Greater than 100 feet	(0 points)

Total	0
-------	---

Wellhead Protection Area:

(Less than 200 feet from a private domestic water source, or; less than 1000 feet from all other water sources)

Yes (20 points)
No (0 points)

Total	0
-------	---

Distance To Surface Water:

(Horizontal distance to perennial lakes, ponds, rivers, streams, creeks, irrigation canals and ditches)

Less than 200 feet	(20 points)	(20 points)
200 feet to 1000 feet	(10 points)	(10 points)
Greater than 1000 feet	(0 points)	(0 points)

Total	0
-------	---

RANKING SCORE (TOTAL POINTS): 0

Date Remediation Started:		N/A		Date Completed:	
Remediation Method:		Excavation:		Approx. cubic yards	
(Check all appropriate sections)		Landfarm		Insitu Bioremediation	
		Other			
Remediation Location:		Onsite		Offsite	
(ie. landfarmed onsite, name and location of offsite facility)					
General Description Of Remedial Action:					
No remediation necessary. Pit was backfilled and reseeded. Pit is in a non-vulnerable area.					
Ground Water Encountered:					
		No	X	Yes	Depth
Final Pit:		Sample location		Center of pit - 3' below bottom	
Closure Sampling:					
(if multiple samples attach sample results and diagram of sample locations and depths)		Sample depth		7'	
		Sample date		2/14/00	Sample time 3:00 PM
Sample Results					
		Benzene (ppm)		0.0118	
		Total BTEX (ppm)		0.0597	
		Field headspace (ppm)		Not measured	
		TPH (ppm)		0.7	
Ground Water Sample:					
		Yes		No	X
(If yes, attach sample results)					
I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF					
DATE		11/15/00		PRINTED NAME John E. Cofer	
SIGNATURE		John E. Cofer		AND TITLE Environmental Coordinator	

--	--	--	--	--

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Conoco	Project #:	707003-128
Sample ID:	Tank Drain	Date Reported:	02-25-00
Laboratory Number:	G879	Date Sampled:	02-14-00
Chain of Custody:	6817	Date Received:	02-24-00
Sample Matrix:	Soil	Date Analyzed:	02-25-00
Preservative:	Cool	Date Extracted:	02-25-00
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	11.8	1.8
Toluene	18.3	1.7
Ethylbenzene	3.8	1.5
p,m-Xylene	17.7	2.2
o-Xylene	8.1	1.0
Total BTEX	59.7	

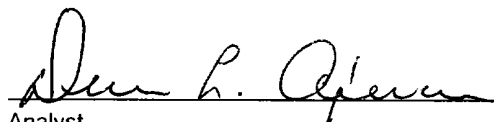
ND - Parameter not detected at the stated detection limit.


Surrogate Recoveries:	Parameter	Percent Recovery
	Trifluorotoluene	100 %
	Bromofluorobenzene	100 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: 28 - 7 #109.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

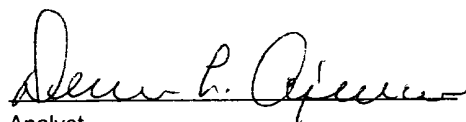
Client:	Conoco	Project #:	707003-128
Sample ID:	Tank Drain	Date Reported:	02-25-00
Laboratory Number:	G879	Date Sampled:	02-14-00
Chain of Custody No:	6817	Date Received:	02-24-00
Sample Matrix:	Soil	Date Extracted:	02-25-00
Preservative:	Cool	Date Analyzed:	02-25-00
Condition:	Cool and Intact	Analysis Requested:	8015 TPH


Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	0.7	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	0.7	0.1

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

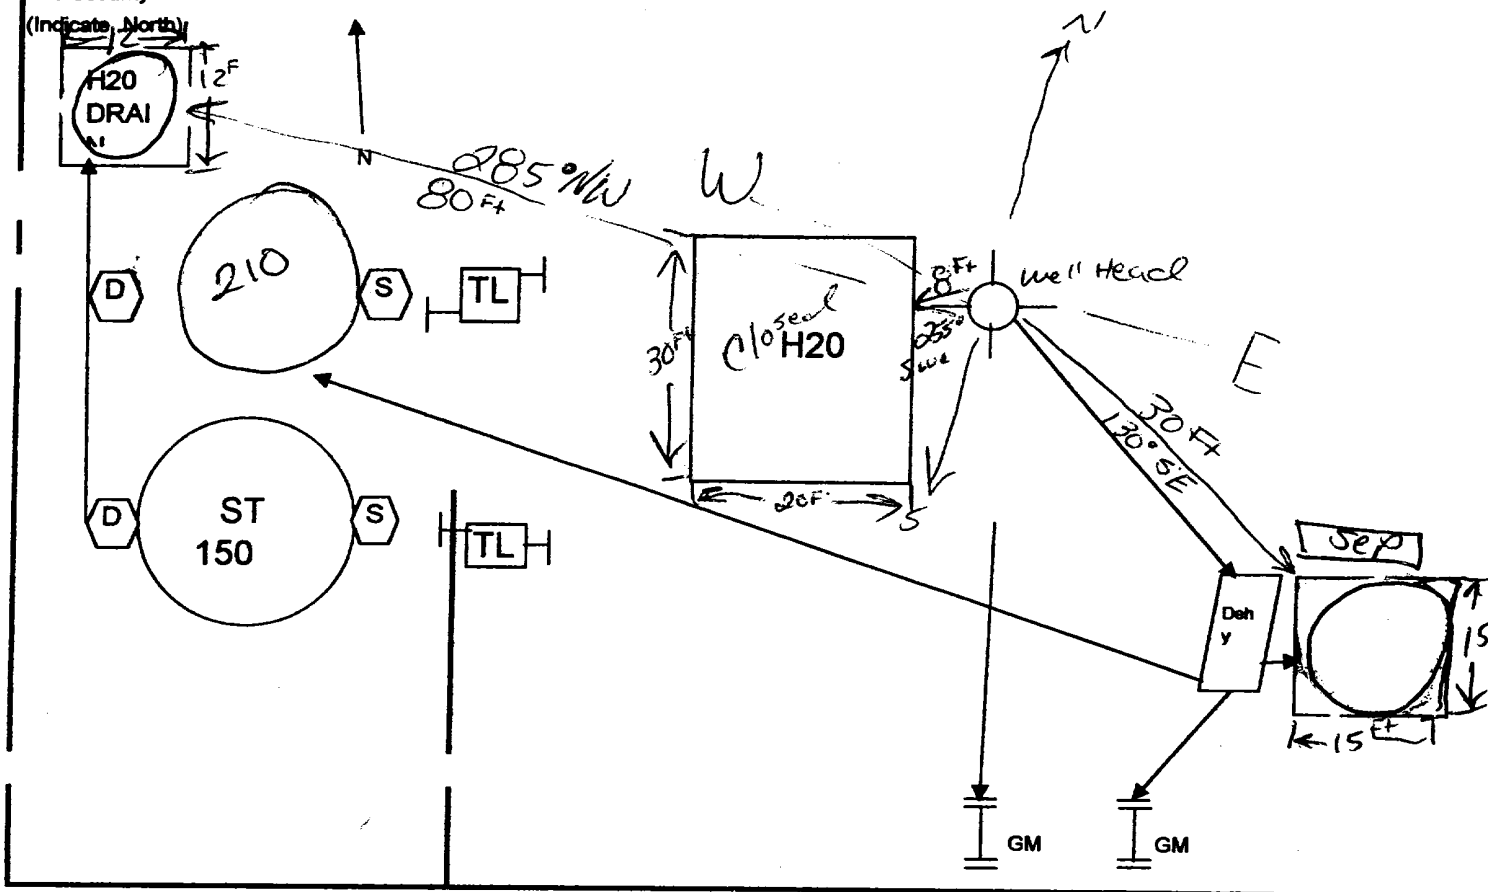
Comments: 28 - 7 #109.


Analyst


Review

Site Security

(Indicate North)



CHAIN OF CUSTODY RECORD

[illegible]