


(SUBMIT IN TRIPLICATE)

Land Office **Santa Fe**
Lease No. **079391**
Unit **San Juan 27-5 Unit**

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

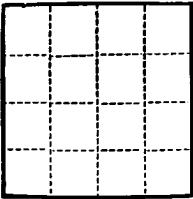

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	X
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 25, 1961

Well No. **3 (PM)** is located **890** ft. from **THE** **S** line and **800** ft. from **THE** **W** line of sec. **9**

S.W. Section 9

Tapacito P. C. Est. & Blanco Mesa Verde

27-N

(Twp.)

5-W

(Range)

N.M.P.M.

(Meridian)

Rio Arriba

(County or Subdivision)

New Mexico

(State or Territory)

The elevation of the derrick floor above sea level is **6736** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 10-21-61 T.D. 5937'.
Ran 71 joints & 1 1/2" 10.5# J-55 casing (82'2")
set from 3675-5937 with 215 lbs cement 1/4 gal, 1/4 cu. ft. Fine Gilsomite and 1/8# Floccale/sk.
Held 1500#/30 minutes.



I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **El Paso Natural Gas Company**

Address **Box 990**

Fernington, New Mexico

By **Original Signed R. C. MILLER**

Title **Petroleum Engineer**