

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 080668
Unit San Juan 27-4 Unit
14-08-001-1054

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	<u>Water Fracture</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

JUL 2 1956
U. S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

Well No. 7 is located 990 ft. from S line and 1700 ft. from W line of sec. 9
SW Section 9 27N 4W RMPM
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Wildcat Rio Arriba New Mexico
 (Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6722 ft.

DETAILS OF WORK

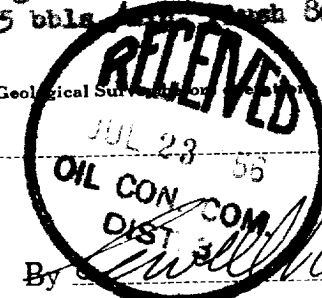
(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

6-12-56 T.D. 8073'. Cleanout depth 8050'. Water fractured Dakota perf. int. 7946-7990 & 8014-8026 w/4 shots/ft. with 85,400 gals. water & 80,000# sand. Maximum pressure 3150#, Avg. tr. pr. 3075#, Inj. rate 32.2 BPM. Flush 8200 gals. Natural gage 734 MCF/D.

6-13-56 T.D. 8073'. Temp. B.P. Set @ 7913'. Water fraced Dakota perf. int. 7870-7884 & 7898-7912 w/4 shots/ft. w/89,400 gals. water & 80,000# sand. Max. pr. 3000#, avg. tr. pr. 2850#. Inj. rate 31.5 bbls./min. Flush 8200 gallons.

6-17-56 T.D. 8073'. Temp. B.P. set @ 7800'. Water fraced Greenhorn perf. int. 7680-7696 & 7720-7750 w/4 shots/ft. w/59,550 gals. water & 50,000# sand. Max. pr. 4000#, avg. tr. pr. 3900#. Inj. rate 31.5 bbls./min. Flush 8030 gallons.

I understand that this plan of work must receive approval in writing by the Geological Survey before work may be commenced.

Company El Paso Natural Gas CompanyAddress Box 997Farmington, New MexicoBy [Signature]
Title Petroleum Engineer

