


FORM IS NOT TO BE
FOR REPORTING
LEAKAGE TESTS IN
NEARLY NEW MEXICO.

NEW MEXICO OIL CONSERVATION COMMISSION NORTHWEST NEW MEXICO PACKER-LEAKAGE TEST

El Paso Natural Gas Company				Well Name and Number San Juan 27-5 Unit #69			
Location of well Twp. 27 Rge. 5 Sec. 7				TYPE OF TEST 1975	Annual - (Give Year)	Initial - (Give Date)	☐ NEW ☐ OWWO
UPPER COMPLETION	Reservoir or Pool MV	☒ GAS ☐ OIL	☒ FLOWING ☐ ARTIFICIAL LIFT	☒ CASING ☒ TUBING			
LOWER COMPLETION	Reservoir or Pool DK	☒ GAS ☐ OIL	☒ FLOWING ☐ ARTIFICIAL LIFT	☐ CASING ☒ TUBING			

Date	Upper Zone		Lower Zone		
	Shut-In		Shut-In	Flow Test	
	Casing	Tubing	Tubing	Tubing	Flow Rate
7-14	431	307	839		
7-15	437	312	866		
7-16	442	317	891		
7-17	447	322		441	407 MCF/D
7-18	453	326		402	364 MCF/D

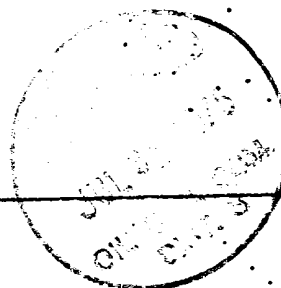

The results of this test indicate (No Packer Leakage) (Packer Leakage) in this well.


I hereby certify that the information above is true and complete to the best of my knowledge and belief.

APPROVED JUL 31 1975
NEW MEXICO OIL CONSERVATION COMMISSION
BY AK Sandwick
PETROLEUM ENGINEER DIST. NO. 3

OPERATOR El Paso Natural Gas Company
BY C. R. Wagner
TITLE Well Test Engineer
DATE 7-30-75

DAYS
 1 2 3 4 5
 PRESSURE Both Zones DK.
 Psig Shut In Flowing
 1400

E P N G
 Annual Packer Leakage Test
 1975
 SAN JUAN 27-5 UNIT #69 (ND)
 Unit A Sec. 07-27-05
 Rio Arriba Co., New Mexico

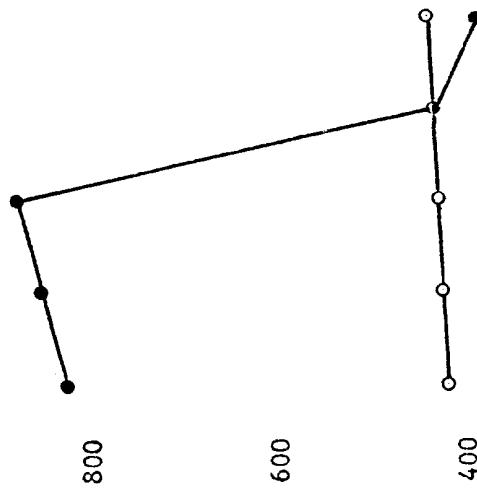

o MV Zone • DK Zone