

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 079393
Unit San Juan 27-5 Unit
14-00-001-950

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 26, 19 60

Well No. 52(FM) is located 800 ft. from S line and 800 ft. from W line of sec. 4

SW/4 Sec. 4 T-27N SW N.M.F.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Wildcat Pictured Cliffs & Rio Arriba New Mexico
Blanco (Field) Mesa Verde (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6629 ft.


DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 8-18-60 Total Depth 5837'.
Ran 58 joints 5 1/2", J-55, 15.5# liner (2273') set from 3561' to 5034' with
215 sacks regular cement, 1/8# Floccle/sk. & 4# Gel, 1/4 cu. ft. Wilsonite.

Held 1000#/30 minutes.

Top of cement at 3561'.

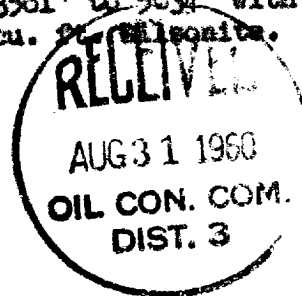

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 999

Farmington, New Mexico

By Original Signed D. W. Meehan

Title Petroleum Engineer