


Land Office Santa Fe
Lease No. 018972
Unit San Juan 20-7 Unit
14-00-001-459

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

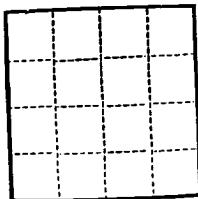

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 22, 1959

Well No. 204 (NW) is located 500 ft. from S line and 1220 ft. from E line of sec. 1

SW 1/4 Sec. 3 (1/4 Sec. and Sec. No.) 77E (Twp.) 7N (Range) N.M.P.M. (Meridian)

So. Placer U.C. & Blanco N.V. (Field) Pio Arriba (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 6721 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 7-31-59 total depth 5767'.
Ran 60 joints 5 1/2", J-55, 15.50# liner (2326') set from 3436.5' to 5764.5'
with 170 sacks regular cement, 170 sacks Pozzolan, 1/4# Flu. sp. / sk, 1/2# fine
turplug/sk. & 6# Gel. followed w/50 sacks Neat cement.

Hold 1000# / 30 minutes.

Top of cement by temperature survey at 3436'.



I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 977

Farmington, New Mexico

By Original Signed By: D.H. Oheim

Title Petroleum Engineer