


Form 9-331a
(Feb. 1951)

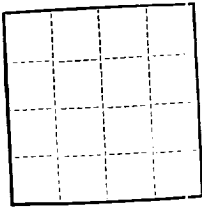

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 079393
Unit San Juan 27-5 Unit
14-01-001-950

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	<u>Water Frac.</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 25, 19 61

Well No. 61 is located 1700 ft. from N line and 1050 ft. from E line of sec. 5.


NE/4 Sec. 5 (1/4 Sec. and Sec. No.)
Blanco Mesa Verde (Field)
27N (Twp.)
5N (Range)
S.M.P.M. (Meridian)
Rio Arriba (County or Subdivision)
New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 6653 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 6-16-61 Total Depth 5419'. C.O.T.D. 5764'. Water fractured Mesa Verde
perf. int. 5754-5766; 5724-5718; 5714-5700; 5700-5694; 5656-5646; 5632-5624
w/63,600 gallons water. BD pr. 1750#, max. pr. 2400#, avg. tr. pr. 2300-2400-2200-2100
3000#. I.R. 17 B.M. C stages - 5 drops.

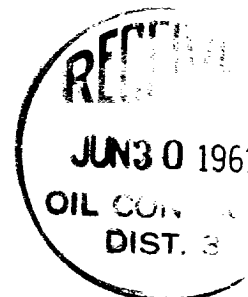

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 290

Farmington, New Mexico

By Original Signed R. G. MILLER

Title Petroleum Engineer