

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Budget Bureau No. 42-R358.4.
Form Approved.

Land Office Santa Fe

Lease No. 079393

Unit San Juan 27-5 Unit

SUNDRY NOTICES AND REPORTS ON WELLS **RECEIVED**

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	SEP 13 1962
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	U. S. GEOLOGICAL SURVEY
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	FARMINGTON, NEW MEXICO
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	X
NOTICE OF INTENTION TO ABANDON WELL	Water Frac	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 12, 19 62

Well No. 76 is located 1460 ft. from N line and 1460 ft. from E line of sec. 5

NE Section 5
(1/4 Sec. and Sec. No.)

27-N
(Twp.)

5-W
(Range)

N.M.P.M.
(Meridian)

Basin Dakota
(Field)

Rio Arriba
(County or Subdivision)


New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is 5537 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 9-1-62, T.D. 7830'. C.O.T.D. 7797'.
Perf 7749-43; 7713-07; 7649-43; 7542-36; (3 SPF).
Frac w/75,000 gallons water, 72,000# sand. Flush w/5600 gallons water.
I.R. 31.5 BPM. Max pr 3950#, BDP 2100#, tr pr 3450-3950#. 3 drops of
9 balls.

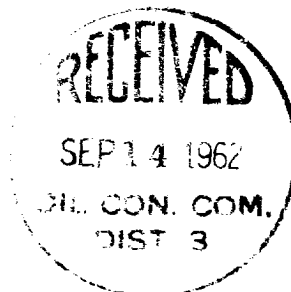

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 990

Farmington, New Mexico

By ORIGINAL SIGNED H.E. McANALLY

Title Petroleum Engineer