

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office San Juan Fe
Lease No. 071065-A
Unit San Juan 28-7 Unit
14-08-001-499

SUNDRY NOTICES AND REPORTS ON WELLS

RECEIVED
FEB 4 1958

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 30, 1958

Well No. 63 is located 1501 ft. from [N] line and 1511 ft. from [E] line of sec. 5

1/4 Sec. 5
(1/4 Sec. and Sec. No.)

21N
(Twp.)

1W
(Range)

N.M.P.M.
(Meridian)

Blanco I. C. Ext.
(Field)

Rio Arriba
(County or Subdivision)

New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is 5702 ft.

DETAILS OF WORK


(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

1-26-58 Total Depth 3415'.

Run 106 joints 5 1/2", 15.90#, J-95 Casing (3406') set at 3416' with 75 sacks regular cement, 75 sacks foamix, 4# Gel, 1/4# Floccul.

Held 1000# for 30 minutes.

Top of cement by temperature survey at 2330'.

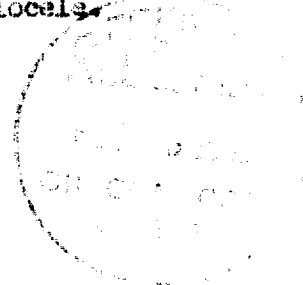

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 987

Farmington, New Mexico

By Original Signed D. C. Johnston

Title Petroleum Engineer