

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Form Approved.  
Budget Bureau No. 42-R1424

**SUNDRY NOTICES AND REPORTS ON WELLS**

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐  
2. NAME OF OPERATOR  
Northwest Pipeline Corporation  
3. ADDRESS OF OPERATOR  
P.O. Box 90, Farmington, N.M. 87401  
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)  
AT SURFACE: 1090' FSL & 1650' FEL  
AT TOP PROD. INTERVAL: Same as above  
AT TOTAL DEPTH: Same as above  
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA


REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
CHANGE ZONES ☐  
ABANDON\* ☐  
(other) ☐


SUBSEQUENT REPORT OF:

☐  
☐  
☐  
☒  
☐  
☐  
☐  
☐  
☐

5. LEASE  
6. IF INDIAN, ALLOTTEE OR TRIBE NAME  
Jicarilla Apache Tribe Contract #92  
7. UNIT AGREEMENT NAME  
8. FARM OR LEASE NAME  
Jicarilla 92  
9. WELL NO.  
#5  
10. FIELD OR WILDCAT NAME  
Tapacito Pictured Cliffs  
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
Sec 31, T27, R3W  
12. COUNTY OR PARISH 13. STATE  
Rio Arriba New Mexico  
14. API NO.  
15. ELEVATIONS (SHOW DF, KDB, AND WD)  
7037' GR

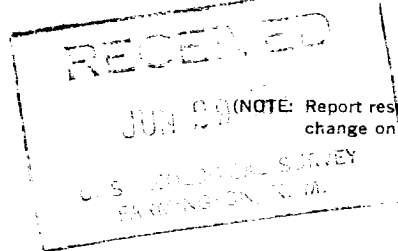

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

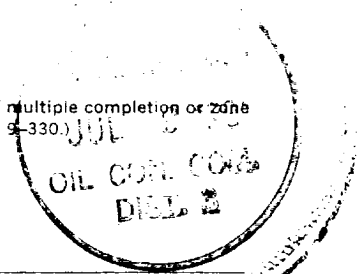

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

On 3-26-81 we squeezed the well as reported in the subsequent Sundry notice dated 4-2-81. However, when the well would not produce to line, we moved the rig back on location and completed the work described below.

6-20-81 McCullough ran Casing Inspection Log.  
6-21-81 Set bridge plug @ 3758'. Squeezed csg leak @ approx 2200' w/ 75 sx cmt.  
6-22-81 Pressure tested to 1600# - OK. Drilled out bridge plug. Blew well w/ compressor to unload wtr.  
6-25-81 Rig down.

Subsurface Safety Valve: Manu. and Type \_\_\_\_\_ Set @ \_\_\_\_\_ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED P.M. Pippin TITLE Sr Prod Engineer DATE 6-26-81  
(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE JUL 8 1981  
CONDITIONS OF APPROVAL, IF ANY:

NMOCC

PMP:djb

\*See Instructions on Reverse Side

BY

FARMINGTON DISTRICT