DEPUTY OIL & GAS INSPECTOR

DEC 2 9 1997

Meter Number:87454 Location Name:San Juan 28 - 7 Unit 165 Location:TN-27 RG-07 SC-16 UL-A

> 1- State NMOCD Zone: OUTSIDE Hazard Ranking Score: 00

DECEIVED N APR 1 4 1997

DIV. DIV. DIST. 3

#### RATIONALE FOR RISK-BASED CLOSURE OF PRODUCTION PITS LOCATED OUTSIDE OF THE VULNERABLE ZONE IN THE SAN JUAN BASIN

This production pit location was ranked according to the criteria in the New Mexico Oil Conservation Division's Unlined Surface Impoundment Closure Guidelines and received a ranking score of zero. The estimated depth to groundwater is greater than 100-feet beneath ground surface (bgs), the pit is not in a well head protection area, and there are no surface water bodies within 1,000 horizontal feet of the pit location.

The primary source, discharge to the pit has been removed. There has been no discharge to the pits for at least 4 years and the pits have been closed for at least one year.

Each pit was backfilled with clean soil and graded in a manner to divert precipitation away from the excavated area. Minimal infiltration of rainfall is expected. Any rainfall that does infiltrate the ground surface must migrate through clean backfill before reaching the residual hydrocarbons.

There is no source material at the ground surface, so direct contact of hydrocarbons with livestock and the populous is not likely.

In general, outside of the vulnerable area and alluvial valleys, bedrock material is generally encountered within 20 feet of the ground surface. Bedrock material in the San Juan Basin consists of interbedded sandstones, shales and clays. According to Freeze and Cherry, 1979, the hydraulic conductivity of the bedrock material are as follows:

Sandstone  $10^{-9}$  to  $10^{-13}$  cm/sec Shale  $10^{-12}$  to  $10^{-16}$  cm/sec Clay  $10^{-12}$  to  $10^{-15}$  cm/sec

Based on this information, the residual hydrocarbons should not migrate to groundwater.

Natural process (bioremediation) are degrading the residual hydrocarbon to carbon dioxide and water and will continue until the source is gone, therefore minimizing any impact to the environment.

Based on the above information, it is highly unlikely that any source material will impact groundwater or ever find an exposure pathway to affect human health and therefore El Paso Field Services Company (EPFS) requests closure of this pit location.



### FIELD PIT SITE ASSESSMENT FORM

GENERAL	Meter: 87454 Location: San Jvan 28-7 Unit 165 Operator #: 0203 Operator Name: Amoro P/L District: Blanco Coordinates: Letter: A Section 16 Township: 27 Range: 7  Or Latitude Longitude Pit Type: Dehydrator Location Drip: Line Drip: Other: Site Assessment Date: 5/3/95 Area: 03 Run: 52					
SITE ASSESSMENT	NMOCD Zone:  (From NMOCD  Maps)  Inside  Outside  Land Type:  BLM  State  (2)  Fee  (3)  Indian  Indian					
	Depth to GroundwaterLess Than 50 Feet (20 points)□ (1)50 Ft to 99 Ft (10 points)□ (2)Greater Than 100 Ft (0 points)☒ (3)					
	Wellhead Protection Area:  Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction?, or; Is it less than 200 ft from a private domestic water source? ☐ (1) YES (20 points) ☒ (2) NO (0 points)					
	Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) ☐ (1) 200 Ft to 1000 Ft (10 points) ☐ (2) Greater Than 1000 Ft (0 points) ☑ (3) Name of Surface Water Body					
	(Surface Water Body : Perennial Rivers,Major Wash,Streams,Creeks, Irrigation Canals,Ditches,Lakes,Ponds) Distance to Nearest Ephemeral Stream [] (1) < 100'(Navajo Pits Only) [] (2) > 100'					
	TOTAL HAZARD RANKING SCORE: POINTS					
REMARKS	Remarks: Redline Book: Outside Vurierable Zone Topo: Ourside					
REM.	PUSH-IN					

<b>-</b> -y-	ORIGINAL PIT LOCATION  Original Pit : a) Degrees from North <u>92°</u> Footage from Wellhead <u>48′</u> b) Length : <u>31′</u> Width : <u>30′</u> Depth : <u>5′</u>
ORIGINAL PIT LOCATION	Wellher 18/ 3)
REMARKS	Remarks: Pictures @ "5:10" hr 21-20
	Completed By:
	Signature Date

# FIELD PIT REMEDIATION/CLOSURE FORM

GENERAL	Meter: 87454 Location: San Juan 28-7 Unit # 165  Coordinates: Letter: A Section 16 Township: 27 Range: 7  Or Latitude Longitude Longitude Date Started: 6/5/95 Run: 03 52
FIELD OBSERVATIONS	Sample Number(s): KD 453  Sample Depth: 7 Feet  Final PID Reading 295 pp. PID Reading Depth 7 Feet  Yes No  Groundwater Encountered
CLOSURE	Remediation Method:  Excavation
	Soil Disposition:  Envirotech
REMARKS	Remarks: Pit Had Aproximately I' of oil + water in it. Dusy Test Hole to 7' It't Sandstore, TOOK DID Sample, Closed pit.
	Signature of Specialist:



# FIELD SERVICES LABORATORY ANALYTICAL REPORT

## PIT CLOSURE PROJECT - Soil Samples Outside the GWV Zone

	SAMPLE	IDENTIFICA	ATION			
	ID		Lab ID			
SAMPLE NUMBER:	KD:	946873				
MTR CODE   SITE NAME:	8745d	N/A				
SAMPLE DATE   TIME (Hrs):	6-5-95		1315			
SAMPLED BY:	N/A					
DATE OF TPH EXT.   ANAL.:				<del></del>		
TYPE   DESCRIPTION:	√ <b>G</b> -		grey sand	grey sand a clay		
REMARKS:		RESULTS				
PARAMETER	RESULT UNIT			QUALIFIERS		
TPH (418.1)	41.44	MG/KG	DF	<u> </u>	M(g)	V(ml) ∼8
HEADSPACE PID	1 <b>47</b> 00 295	PPM				
PERCENT SOLIDS	83.7	%				
		TPH is by EPA Meth	oc 418.1 ···			
Harrative:						
F = Dilution Factor Used						
Approved By:			Date:	665/		

Oil and Grease and Petroleum Hydrocarbons in Water and Soil

ILLEGIBLE

95/06/07 14:51

Sample identification 748873


Initial mass of sample, g

Volume of sample after extraction:  $\alpha 1$  28,000

Petroleum hydrocarbons, Jpm 16672.786 Net Absorbance of hydrocarbons (2930 cm-1) 0.474

Y: Petholeum hydrocarbons spectrum

14:51

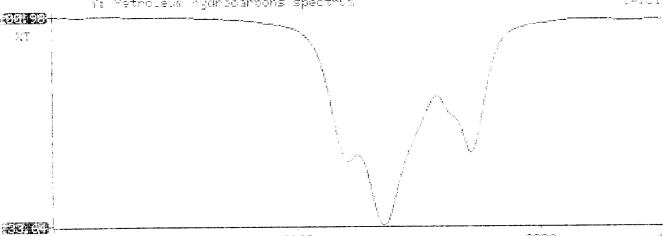

3269

3999

2860

200