

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE\*  
(Other instructions on reverse side)

Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 079392

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER		7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR		San Juan 27-5 Unit
3. ADDRESS OF OPERATOR		8. FARM OR LEASE NAME
Box 990, Farmington, New Mexico 87401		San Juan 27-5 Unit
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface		9. WELL NO.
1600' S, 1180'E.		179
14. PERMIT NO.		10. FIELD AND POOL, OR WILDCAT
15. ELEVATIONS (Show whether DF, RT, GR, etc.)		Tapacito Pictured Cliffs
6462' G.L.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
		Sec. 17, T-27-N, R-5-W
		N.M.P.M.
		12. COUNTY OR PARISH
		Rio Arriba
		13. STATE
		New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON\*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*


(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

3-17-74: Tested surface casing; held 600#/30 minutes.

3-21-74: T.D. 3369'. Ran 111 joints 2-7/8", 6.4# J-55 production casing, 3359' set at 3369'. Baffle set at 3359'. Cemented with 247 cu.ft. cement. Waiting on cement 18 hours. Top of cement at 2255'.

5- 7-74: Tested casing to 4000# - OK.  
P.B.T.D. 3359'. Perf'd 3250-70' with 20 SPZ. Frac'd with 28,000# 10/20 sand and 24,410 gallons treated water. Dropped no balls. Flush with 810 gallons water.

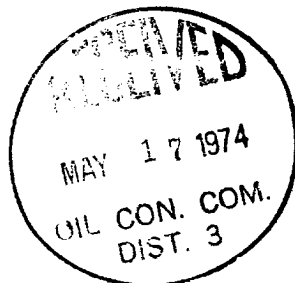

18. I hereby certify that the foregoing is true and correct

SIGNED A. J. Buices

TITLE Drilling Clerk

DATE May 8, 1974

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side