

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE\*  
(Other instructions on re-  
verse side)

Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

**Contract 235**

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

**Jicarilla Apache**

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

**Jicarilla 235**

9. WELL NO.

**1 (R-13)**

10. FIELD AND POOL, OR WILDCAT

**Wildcat**

11. SEC., T., R., N., OR BLK. AND  
SURVEY OR AREA

**Sec. 13, T-27N, R-1W**

12. COUNTY OR PARISH 13. STATE

**Rio Arriba New Mexico**

1.

OIL WELL ☒ GAS WELL ☐ OTHER

2. NAME OF OPERATOR

**BENSON-MONTIN-GREEK DRILLING CORP.**

3. ADDRESS OF OPERATOR

**221 Petroleum Center Building, Farmington, New Mexico**

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*

See also space .7 below.)  
At surface

**825' ISL, 495' FEL, Sec. 13, T-27N, R-1W**

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☒

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON\*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*



(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

**9- 7-66 TD 4002' RKB. Set 125 joints 4007.53' of 7" OD 20# J-55 casing, set at 3999' RKB, cemented with 200 sacks regular cement, 1% gel, 12# Gilsontite per sack, 1# floccle per sack, followed by 100 sacks regular cement, 1# floccle per sack.**

**Temperature survey showed top of cement at 2950'.**

**11-23-66 Drilled cement and 1' of shale of 4000'. 4-hour bailing test recovered no water.**

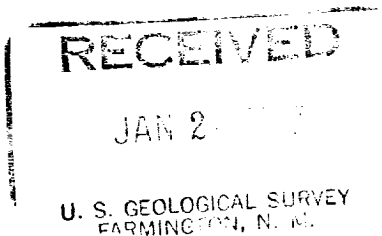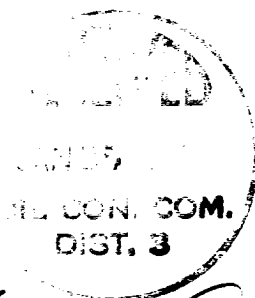

18. I hereby certify that the foregoing is true and correct

SIGNED

*Walter C. Smith*

TITLE

**Engineer**

DATE

**1-23-67**

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE