

Santa Fe


Land Office

Lease No. 079360

Unit Rincon Unit

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

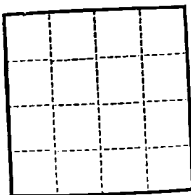

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	X
NOTICE OF INTENTION TO ABANDON WELL	Water Frac.	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

December 7, 1959

Well No. 136 (MD) is located 1180 ft. from ~~xxx~~ [N] line and 990 ft. from ~~xxx~~ [E] line of sec. 23


NE/4 Sec. 23 27N 7W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco M.V. & Dakota Wildcat Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6628 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

12-6-59 Total Depth 7697'. P.B.T.D. 7305'. Water fractured Point Lookout perf. int. 5360-70, 5388-98; 5406-5414; 5424-34; 5454-68; 5482-92 with 60,600 gallons water and 70,000# sand. BD pr. none, max. pr. 1650#, avg. tr. pr. 350, 650-700, 1050, 1550#. I.R. 52.1 BPM. Flush 15,000 gallons. Dropped 2 sets of 30 balls, and 2 sets of 20 balls for 5 stages.

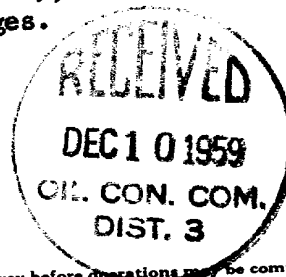

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997
Farmington, New Mexico

By ORIGINAL SIGNED G.H. MEANS
Title Petroleum Engineer

