

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease
State <input type="checkbox"/> Fed. <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER-	7. Unit Agreement Name
2. Name of Operator <b>El Paso Natural Gas Company</b>	8. Farm or Lease Name <b>Whan Jones</b>
3. Address of Operator <b>Box 990, Farmington, New Mexico 87401</b>	9. Well No. <b>2 (P&amp;A)</b>
4. Location of Well UNIT LETTER <b>L</b> , <b>1480</b> FEET FROM THE <b>South</b> LINE AND <b>790</b> FEET FROM THE <b>West</b> LINE, SECTION <b>30</b> TOWNSHIP <b>26N</b> RANGE <b>8W</b> NMPM.	10. Field and Pool, or Wildcat <b>Basin Dakota</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>6259' GL</b>	12. County <b>San Juan</b>

## Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

### NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

### SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>



17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

This well has been plugged and abandoned as follows:

Spotted a 50 sack cement plug down tubing to cover perforated interval (6296-6497'). Pulled tubing.

Shot 4 1/2" casing off at 1619', spotted a 30 sack plug on stub, pulled up to base of surface casing and spotted a 30 sack plug.

Placed a 10 sack plug in surface w/a 4' x 4" P & A marker, K clean location.

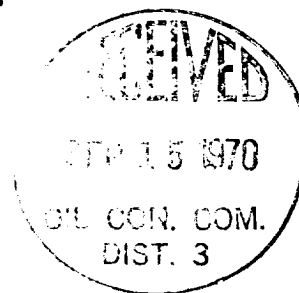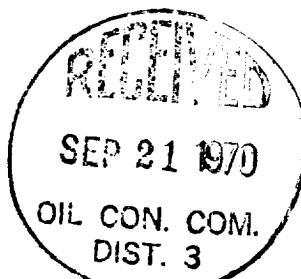

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Original Signed F. H. WOOD

SIGNED \_\_\_\_\_ TITLE **Petroleum Engineer** DATE **9-4-70**

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: