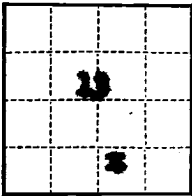


(SUBMIT IN TRIPLICATE)

Indian Agency Window RockUNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee _____

Lease No. 14-22-402-725

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	<u>Not Production Casing</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 3, 1957

Well No. 2 is located 640 ft. from S line and 2900 ft. from E line of sec. 13
G-25, 26 Section 13 24N 10E New Mexico P.M.
 (34 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
San Juan New Mexico
 (Field) (County or Subdivision) (State or Territory)

The elevation of the ground level above sea level is 6446 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled to 5325' SB, SB. Conditioned hole and ran 146 joints 5-1/2" OD, SB, 146, 3-55 SB. Casing, equipped with centralizers, sweepers and Baker Blast Equipment. Casing landed at 5324' SB and cemented with 100 oz SB Oil Cement. Displaced to 5358' SB under 1500' psi. Ran temperature survey, found top of cement at 4700' SB.



I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company The British-American Oil Producing CompanyAddress Box 180
Denver 1, ColoradoOriginal Signed By Thomas M. Hogan
By _____Title District Superintendent