

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **BP**
Lease No. **079679**
Unit **Delhi-Taylor**

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	X
NOTICE OF INTENTION TO ABANDON WELL.....	Sandell Frac.	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

March 3, 19 **58**

Well No. **4** is located **1930** ft. from **N** line and **640** ft. from **E** line of sec. **17**
SE NE/4 Section 17 **26-N** **11-W** **NMPM**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Undesignated **San Juan** **New Mexico**
(Field) (County or Subdivision) (State or Territory)


The elevation of the derrick floor above sea level is **6202** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

3-2-58 Total Depth 5387'. Clean Out Total Depth 5221'.

Sandell fractured Gallup perforated intervals 5279'-5309' (4 sh./ft.) with 41,160 gal. oil and 40,000# sand. Breakdown pressure 2400#, Max. TP 2375#. Injection Rate 52.5 bbls./min. Finish 5,460 gallons.

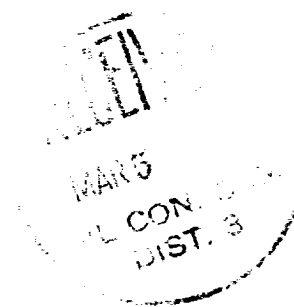

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **El Paso Natural Gas Products Company**

Address **Post Office Box 1566**
Farmington, New Mexico

ORIGINAL SIGNED BY: JOSEPH E. KREGER

By _____
 Title **Petroleum Engineer**