


ILLEGIBLE

Land Office Santa Fe
Lease No. SF 078392
Unit O. H. Randal

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

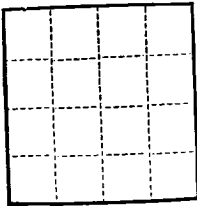

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	Report of Squeeze Job Nos. 1, 2, 3, 4 X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

April 29, 1959

O. H. Randal
Well No. 1 is located 1850 ft. from N line and 1850 ft. from W line of sec. 14

SE 1/4 Sec. 14 26N 11W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Wildcat - Gallup & Dakota San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6446 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

SQUEEZE JOB NO. 1: Squeezed 7" casing perfs. at 5686' w/200 sks. reg. cement. BDP 2300#, Max. Squeeze Pressure 2500#, Min. Squeeze Pressure 0. Did not squeeze.

SQUEEZE JOB NO. 2: Halliburton squeeze tool set at 5686'. Squeezed 7" casing perfs. at 5686' w/100 sks. reg. cement, put 88 sks. cement in formation & backwashed 12 sks. BDP 2400#, Max. pressure 4000#, Min. pressure -0-, squeeze pressure 4000#.

SQUEEZE JOB NO. 3: Squeezed 7" casing perfs. at 5500' w/100 sks. reg. cement. BDP 1400#, Max. pressure 2000#, Min. pressure -0-. Did not squeeze.

SQUEEZE JOB NO. 4: Halliburton RTTS packer set at 5424'. Squeezed 7" casing perfs. at 5400' w/100 sks. reg. cement, 45 gal. Put 90 sks. in formation & backwashed 10 sks. BDP 1000#, Max. pressure 3500#, Min. pressure -0-, squeeze pressure 3500#.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company SKELLY OIL COMPANY
Box 426
Address Farmington, New Mexico

By (Signed) P. E. Oster
Title District Superintendent