


FIELD PIT SITE ASSESSMENT FORM

10	GENERAL	Meter: <u>70887</u> Location: <u>Huerfanito N^o 69</u> Operator #: <u>2999</u> Operator Name: <u>Meridian P/L</u> District: <u>Ballard</u> Coordinates: Letter: <u>D</u> Section <u>10</u> Township: <u>26N</u> Range: <u>9W</u> Or Latitude _____ Longitude _____ Pit Type: Dehydrator _____ Location Drip: ☒ Line Drip: _____ Other: _____ Site Assessment Date: <u>6-21-94</u> Area: <u>11</u> Run: <u>91</u>
	SITE ASSESSMENT	NMOCD Zone: (From NMOCD Maps) Inside ☒ (1) Outside ☐ (2) Land Type: BLM ☒ (1) State ☐ (2) <u>Dennis & Trust</u> (3) DEPUTY OIL & GAS INSPECTOR SEP 10 1996 Depth to Groundwater Less Than 50 Feet (20 points) ☒ (1) 50 Ft to 99 Ft (10 points) ☐ (2) Greater Than 100 Ft (0 points) ☐ (3) Wellhead Protection Area : Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction? , or ; Is it less than 200 ft from a private domestic water source? ☐ (1) YES (20 points) ☒ (2) NO (0 points) Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) ☐ (1) 200 Ft to 1000 Ft (10 points) ☒ (2) Greater Than 1000 Ft (0 points) ☐ (3) Name of Surface Water Body <u>Reed Canyon Wash</u> (Surface Water Body : Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds) Distance to Nearest Ephemeral Stream ☐ (1) < 100' (Navajo Pits Only) ☐ (2) > 100' TOTAL HAZARD RANKING SCORE: <u>30</u> POINTS
	MARKS	Remarks : <u>One pit on location - Dry</u> <u>Traverse 117 on Redline & Town</u>

ORIGINAL PIT LOCATION

Original Pit : a) Degrees from North 350° Footage from Wellhead 102
 b) Length : 14 Width : 14 Depth : 3

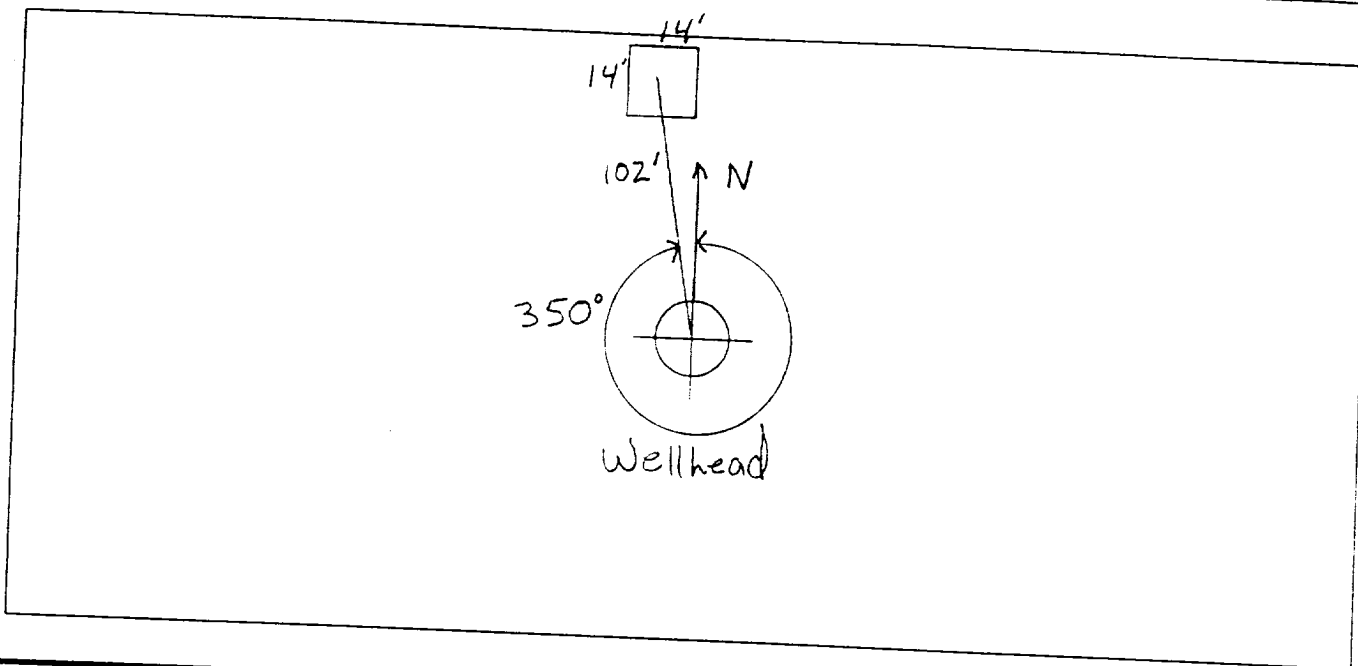

Remarks :

Photos - 1459

End dump

Completed By:


F. Walt

Signature

6-21-94

Date

FIELD PIT REMEDIATION/CLOSURE FORM

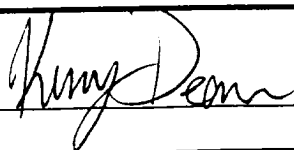GENERAL	Meter: <u>70887</u> Location: <u>Huerfano # 69</u> Coordinates: Letter: <u>D</u> Section <u>10</u> Township: <u>26</u> Range: <u>9</u> Or Latitude _____ Longitude _____ Date Started : <u>8/15/94</u> Run: <u>11</u> <u>91</u>
FIELD OBSERVATIONS	Sample Number(s): <u>KD 214</u> Sample Depth: <u>12</u> Feet Final PID Reading <u>0 ppm</u> PID Reading Depth <u>12'</u> Feet Yes No Groundwater Encountered ☐ ☒ Approximate Depth _____ Feet
CLOSURE	Remediation Method : Excavation Onsite Bioremediation Backfill Pit Without Excavation ☐ Approx. Cubic Yards <u>0</u> ☐ ☒ Soil Disposition: Envirotech ☐ Other Facility ☐ ☐ Tierra Name: _____ Pit Closure Date: <u>8/15/94</u> Pit Closed By: <u>BEI</u>
REMARKS	Remarks : <u>Dug test hole to 12', NO contamination revealed,</u> <u>Took PID sample, closed pit!</u>
Signature of Specialist: <u></u>	



FIELD SERVICES LABORATORY

ANALYTICAL REPORT

PIT CLOSURE PROJECT - Soil Samples Inside the GWV Zone

SAMPLE IDENTIFICATION

SAMPLE NUMBER:

MTR CODE | SITE NAME:

SAMPLE DATE | TIME (Hrs):

SAMPLED BY:

DATE OF TPH EXT. | ANAL.:

DATE OF BTEX EXT. | ANAL.:

TYPE | DESCRIPTION:

Field ID

Lab ID

KD 214	945936
70887	N/A
8-15-94	1235
N/A	
8-16-94	8-16-94
8/17/94	8/20/94
VG	Fine Brown Sand

REMARKS:

RESULTS

PARAMETER	RESULT	UNITS	QUALIFIERS			
			DF	Q	M(g)	V(ml)
BENZENE	LO.025	MG/KG	1			
TOLUENE	LO.025	MG/KG	1			
ETHYL BENZENE	LO.025	MG/KG	1			
TOTAL XYLENES	LO.025	MG/KG	1			
TOTAL BTEX	LO.10	MG/KG				
TPH (418.1)	776	MG/KG			2.11	28
HEADSPACE PID	0	PPM				
PERCENT SOLIDS	93.5	%				

-- TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 --

The Surrogate Recovery was at 85 % for this sample All QA/QC was acceptable.

Narrative:

ATT I results attached.

F = Dilution Factor Used

Approved By:

Date:

9/2/94



Analytical **Technologies**, Inc.

2709-D Par American Freeway, NE Albuquerque, NM 87107
Phone (505) 344-3777 FAX (505) 344-4413

ATI I.D. 408364

August 24, 1994

El Paso Natural Gas Company
P.O. Box 4990
Farmington, NM 87499

Project Name/Number: PIT CLOSURE 24324

Attention: John Lambdin


On 08/17/94, Analytical Technologies, Inc., (ADHS License No. AZ0015), received a request to analyze **non-aqueous** samples. The samples were analyzed with EPA methodology or equivalent methods. The results of these analyses and the quality control data, which follow each set of analyses, are enclosed.

If you have any questions or comments, please do not hesitate to contact us at (505) 344-3777.


H. Mitchell Rubenstein, Ph.D.
Laboratory Manager

MR:jt

Enclosure

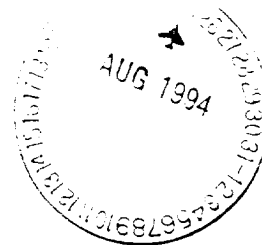



Analytical Technologies, Inc.

GAS CHROMATOGRAPHY RESULTS

TEST : BTEX (EPA 3020)
CLIENT : EL PASO NATURAL GAS CO. ATI I.D.: 408364
PROJECT # : 24324
PROJECT NAME : PIT CLOSURE

SAMPLE ID. #	CLIENT I.D.	MATRIX	DATE SAMPLED	DATE EXTRACTED	DATE ANALYZED	DIL. FACTOR
22	945934	NON-AQ	08/15/94	08/17/94	08/20/94	50
23	945935	NON-AQ	08/15/94	08/17/94	08/20/94	1
24	945936	NON-AQ	08/15/94	08/17/94	08/20/94	1
PARAMETER			UNITS	22	23	24
BENZENE			MG/KG	<1.3	<0.025	<0.025
TOLUENE			MG/KG	<1.3	<0.025	<0.025
ETHYLBENZENE			MG/KG	3.9	<0.025	<0.025
TOTAL XYLENES			MG/KG	96	<0.025	<0.025

SURROGATE:

BROMOFLUOROBENZENE (%)	NA*	85	85
------------------------	-----	----	----

*SURROGATE RECOVERY NOT OBTAINABLE DUE TO SAMPLE DILUTION