


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 077935
Unit Huerfano Unit

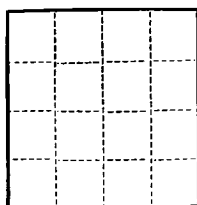

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 13, 1960

Well No. 115(GD) is located 900 ft. from N line and 1550 ft. from W line of sec. 12


NE/4 SW/4 12 26-N 10-W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Angel Peak, Gallup Dist. San Juan New Mexico
Sakota Wilcox (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5557 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 10-10-60, Total Depth 7008.
Ran 174 joints 7" H-80 & J-55, 23 #, Casing (6996') set
at 7005'. DV tool at 2457.
1st Stage 165 sks regular w/4 # Gel, 0.4 # IR-4, 1/4
tuff plug, 1/4 # Floccs/sk. , 50 sks. regular w/0.4 #
IR-4.
2nd Stage 70 sks. regular.
Held 1000 # 30 minutes.
Top of cement by temperature survey at 1750'.

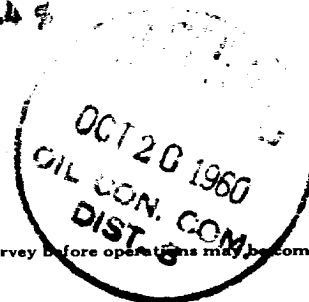

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 790
Farmington, New Mexico

By Original Signed D. W. Meehan

Title Petroleum Engineer