

New Mexico

(SUBMIT IN TRIPLICATE)


UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office

03523

Lease No.

Unit

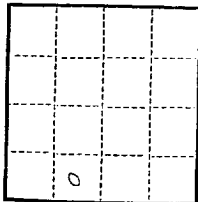

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Holloway

May 9

19 57

Well No. 1 is located 660 ft. from TNT line and 1980 ft. from E line of sec. 6
SE SW Sec. 6 26N 11W NMPM
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Hildcat San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6078 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spudded well on May 4, 1957. We ran 6 joints of new seamless 24 1/2" J-55, 8 5/8" O.D. to 211' & cemented with 125 sack of neat cement. Cement circulated to surface. W.O.C.- 24 hrs. Tested pipe for 2 hours with 500#--- no pressure loss. Rigged up Baroid mud wagon and resumed drilling operations.



I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Western Development Co. of DelawareAddress P. O. Box 445Artesia, New Mexico

By

W B Macey

Title

Vice-President

