

FIELD PIT SITE ASSESSMENT FORM

8

GENERAL	Meter: <u>92503</u> Location: <u>Huerfano No. 68</u> Operator #: <u>2999</u> Operator Name: <u>Meridian P/L</u> District: <u>Ballard</u> Coordinates: Letter: <u>M</u> Section <u>3</u> Township: <u>26N</u> Range: <u>9W</u> Or Latitude _____ Longitude _____ Pit Type: Dehydrator _____ Location Drip: ☒ Line Drip: _____ Other: _____ Site Assessment Date: <u>6-23-94</u> Area: <u>11</u> Run: <u>51</u>
SITE ASSESSMENT	NMOCD Zone: (From NMOCD Maps) Inside ☒ (1) Outside ☐ (2) Land Type: BLM ☒ (1) State ☐ (2) Fee ☐ (3) Depth to Groundwater Less Than 50 Feet (20 points) ☒ (1) 50 Ft to 99 Ft (10 points) ☐ (2) Greater Than 100 Ft (0 points) ☐ (3) Wellhead Protection Area : Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction? , or ; Is it less than 200 ft from a private domestic water source? ☐ (1) YES (20 points) ☒ (2) NO (0 points) Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) ☐ (1) 200 Ft to 1000 Ft (10 points) ☒ (2) Greater Than 1000 Ft (0 points) ☐ (3) Name of Surface Water Body <u>Reed Canyon Wash</u> (Surface Water Body : Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds) Distance to Nearest Ephemeral Stream ☐ (1) < 100' (Navajo Pits Only) ☐ (2) > 100' TOTAL HAZARD RANKING SCORE: <u>30</u> POINTS
REMARKS	Remarks : <u>Two pits on location. one with tank</u> <u>Drip pit is dry</u>

Deborah S. Frost
DEPUTY OIL & GAS INSPECTOR

SEP 10 1996


RECEIVED
APR - 4 1996

OIL CON. DIV.
DIST. 3

ORIGINAL PIT LOCATION

ORIGINAL PIT LOCATION

Original Pit : a) Degrees from North 207 Footage from Wellhead 103
b) Length : 13 Width : 12 Depth : 3

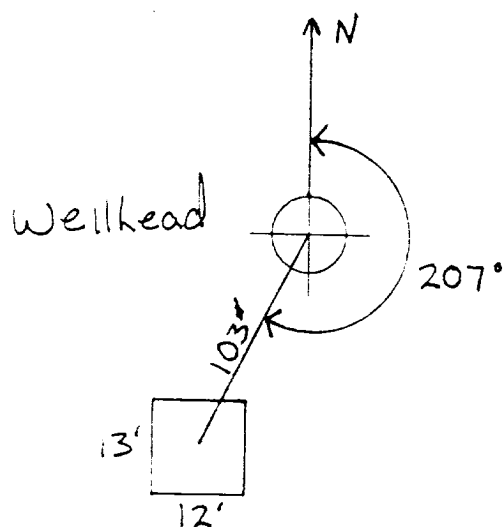


REMARKS

Remarks

Photos - 1256

End dump

Completed By:

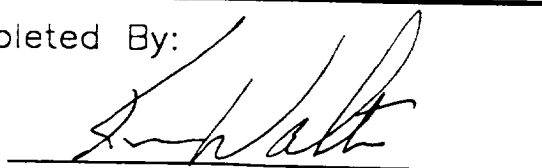

Signature

6-23-94

Date

FIELD PIT REMEDIATION/CLOSURE FORM

GENERAL	Meter: <u>92503</u> <u>70887</u> KOK 8/15/94 Location: <u>Huerfano NO. 69</u> ⁶⁸ KOK 8/15/94 Coordinates: Letter: <u>D</u> ^m KOK 8/15/94 Section: <u>10</u> ³ KOK 8/15/94 Township: <u>26</u> Range: <u>9</u> Or Latitude _____ Longitude _____ Date Started : <u>8-12-94</u> Run: <u>11</u> <u>91</u> ⁵¹ KOK 8/16/94
FIELD OBSERVATIONS	Sample Number(s): <u>KP183</u> Sample Depth: <u>12'</u> Feet Final PID Reading <u>000</u> PID Reading Depth <u>12'</u> Feet Yes No Groundwater Encountered ☐ ☒ Approximate Depth _____ Feet
CLOSURE	Remediation Method : Excavation ☐ Approx. Cubic Yards <u>5</u> Onsite Bioremediation ☐ Backfill Pit Without Excavation ☒ Soil Disposition: Envirotech ☒ <u>312194 PR</u> ☐ Tierra Other Facility ☐ Name: _____ Pit Closure Date: <u>8-12-94</u> Pit Closed By: <u>B.EI</u>
REMARKS	Remarks : <u>Some little marker. Pit looked clean dug test hole</u> <u>sample 600 closed pit</u> <u>* corrections made as per request by Lynn Swabber of DEL</u>
	Signature of Specialist: <u>Kelly Padella</u>



FIELD SERVICES LABORATORY
ANALYTICAL REPORT

PIT CLOSURE PROJECT - Soil Samples Inside the GWV Zone

SAMPLE IDENTIFICATION

	Field ID	Lab ID
SAMPLE NUMBER:	KP 33 KDK 8/15/94	945917
MTR CODE SITE NAME:	70887 92503	N/A
SAMPLE DATE TIME (Hrs):	8/12/94	1120
SAMPLED BY:	N/A	
DATE OF TPH EXT. ANAL.:	8/16/94	8/16/94
DATE OF BTEX EXT. ANAL.:	8/17/94	8/23/94
TYPE DESCRIPTION:	VG	Fine Brown Sand, clay

REMARKS:

RESULTS

PARAMETER	RESULT	UNITS	QUALIFIERS			
			DF	Q	M(g)	V(ml)
BENZENE	LC.025	MG/KG	1			
TOLUENE	LC.025	MG/KG	1			
ETHYL BENZENE	LC.025	MG/KG	1			
TOTAL XYLENES	LC.025	MG/KG	1			
TOTAL BTEX	LC.10	MG/KG				
TPH (418.1)	65.4	MG/KG			2.02	25
HEADSPACE PID	0	PPM				
PERCENT SOLIDS	92.3	%				

-- TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 --

Surrogate Recovery was at 88% for this sample All QA/QC was acceptable.
Narrative:

ATI results attached.

DF = Dilution Factor Used

Approved By:

A.S.

Date:

9/2/94



2709-D Pan American Freeway, NE Albuquerque, NM 87107
Phone (505) 344-3777 FAX (505) 344-4412

August 04, 1994

El Paso Natural Gas Company
P.O. Box 4990
Farmington, NM 87499

Project Name/Number: PIT CLOSURE 24324

Attention: John Lambdin

On 08/17/94, Analytical Technologies, Inc., (ADHS License No. A20015), received a request to analyze **non-aqueous** samples. The samples were analyzed with EPA methodology or equivalent methods. The results of these analyses and the quality control data, which follow each set of analyses, are enclosed.


If you have any questions or comments, please do not hesitate to contact us at (505) 344-3777.

[illegible]

H. Mitchell Rubenstein, Ph.D.
Laboratory Manager

NR: 11

Enclosure

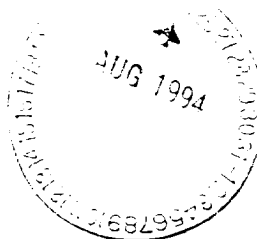



Analytical Technologies, Inc.

GAS CHROMATOGRAPHY RESULTS

TEST : BTEX (EPA 8020)
CLIENT : EL PASO NATURAL GAS CO. ATI I.D.: 408364
PROJECT # : 24324
PROJECT NAME : PIT CLOSURE

SAMPLE ID. #	CLIENT I.D.	MATRIX	DATE SAMPLED	DATE EXTRACTED	DATE ANALYZED	DIL. FACTOR
16	945917	NON-AQ	08/12/94	08/17/94	08/23/94	1
17	945918	NON-AQ	08/12/94	08/17/94	08/19/94	1
18	945919	NON-AQ	08/12/94	08/17/94	08/19/94	1
PARAMETER			UNITS	16	17	1
BENZENE			MG/KG	<0.025	<0.025	<0.025
TOLUENE			MG/KG	<0.025	<0.025	<0.025
ETHYLBENZENE			MG/KG	<0.025	<0.025	<0.025
TOTAL XYLENES			MG/KG	<0.025	<0.025	<0.025

SURROGATE:

BROMOFLUOROBENZENE (%) 88 99 0