


FIELD PIT SITE ASSESSMENT FORM

GENERAL	Meter: <u>75956</u> Location: <u>Graham B WN Fed Natl.</u> Operator #: <u>0286</u> Operator Name: <u>Conoco</u> P/L District: <u>Blanco</u> Coordinates: Letter: <u>NQ</u> ^{cm s/3/4/4} Section: <u>3</u> Township: <u>27</u> Range: <u>8</u> Or Latitude _____ Longitude _____ Pit Type: Dehydrator _____ Location Drip: ☒ Line Drip: _____ Other: _____ Site Assessment Date: <u>5/24/94</u> Area: <u>13</u> Run: <u>31</u>
SITE ASSESSMENT	NMOCD Zone: (From NMOCD Maps) Inside ☒ (1) Outside ☐ (2) Depth to Groundwater Less Than 50 Feet (20 points) ☒ (1) 50 Ft to 99 Ft (10 points) ☐ (2) Greater Than 100 Ft (0 points) ☐ (3) Wellhead Protection Area : Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction? , or ; Is it less than 200 ft from a private domestic water source? ☐ (1) YES (20 points) ☒ (2) NO (0 points) Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) ☒ (1) 200 Ft to 1000 Ft (10 points) ☐ (2) Greater Than 1000 Ft (0 points) ☐ (3) Name of Surface Water Body <u>Largo Canyon</u> (Surface Water Body : Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds) Distance to Nearest Ephemeral Stream ☐ (1) < 100' (Navajo Pits Only) ☐ (2) > 100' TOTAL HAZARD RANKING SCORE: <u>40</u> POINTS Land Type: BLM ☒ (1) State ☐ (2) Fee ☐ (3) <i>Denny L. Ford</i> DEPUTY OIL & GAS INSPECTOR SEP 10 1996 RECEIVED APR - 4 1996 OIL CON. DIV.
REMARKS	Remarks : <u>Redline + Vuln - Inside</u> <u>Pit. Will Close - Pit Dry</u> <u>Redline book shows site in Unit N. Sign on location shows D</u> <u>NIG + HAUL</u>

ORIGINAL PIT LOCATION

ORIGINAL PIT LOCATION

Original Pit : a) Degrees from North 115° Footage from Wellhead 65'
b) Length : 16' Width : 15' Depth : 1'

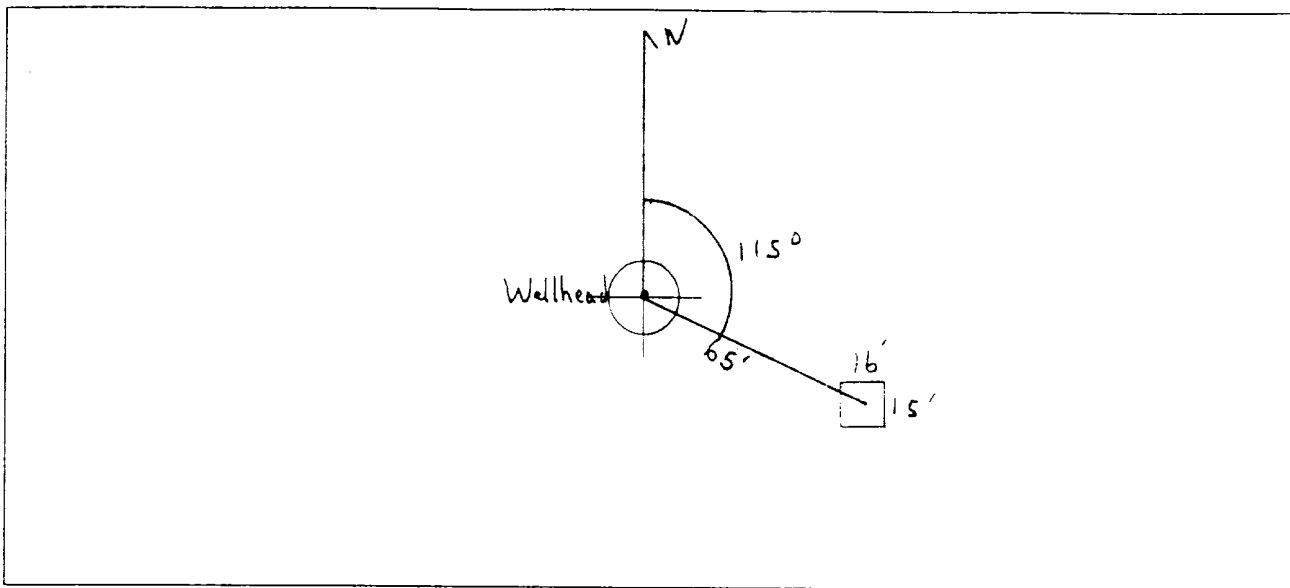

REMARKS

Remarks :

Pictures @ 0853 (1376)
Dump Truck

Completed By:

Cory Chance
Signature

5/24/92
Date

FIELD PIT REMEDIATION/CLOSURE FORM

GENERAL	Meter: <u>175956</u> Location: <u>Graham B WH FED No 6</u> Coordinates: Letter: <u>N</u> Section <u>3</u> Township: <u>27</u> Range: <u>8</u> Or Latitude _____ Longitude _____ Date Started : <u>6-7-94</u> Area: <u>13</u> Run: <u>31</u>
FIELD OBSERVATIONS	Sample Number(s): <u>KP#87</u> <u>KP#88</u> <u>KP#89</u> Sample Depth: <u>12</u> Feet Final PID Reading <u>000</u> PID Reading Depth <u>12'</u> Feet Yes No Groundwater Encountered ☐ (1) ☒ (2) Approximate Depth _____ Feet
CLOSURE	Remediation Method : Excavation ☒ (1) Approx. Cubic Yards <u>0</u> Onsite Bioremediation ☐ (2) Backfill Pit Without Excavation ☐ (3) Soil Disposition: Envirotech ☐ (1) ☒ (3) Tierra Other Facility ☐ (2) Name: _____ Pit Closure Date: <u>6-7-94</u> Pit Closed By: <u>B.E.I</u>
REMARKS	Remarks : <u>Pit look clean Dug A 12' sample hole</u> <u>PID 000 Closed Pit. Some line markers on location.</u>
	Signature of Specialist: <u>Kelly F. Hill</u>



FIELD SERVICES LABORATORY
ANALYTICAL REPORT
PIT CLOSURE PROJECT - Soil

SAMPLE IDENTIFICATION

	Field ID	Lab ID
SAMPLE NUMBER:	KP 27	945381
MTR CODE SITE NAME:	754CL	N/A
SAMPLE DATE TIME (Hrs):	6-7-94	1500
SAMPLED BY:	N/A	
DATE OF TPH EXT. ANAL.:	6/10/94	6/10/94
DATE OF BTEX EXT. ANAL.:	6/17/94	6/17/94
TYPE DESCRIPTION:	VG	Fine Brown Sand

REMARKS:

RESULTS

PARAMETER	RESULT	UNITS	QUALIFIERS			
			DF	Q	M(g)	V(ml)
BENZENE	<0.025	MG/KG				
TOLUENE	<0.025	MG/KG				
ETHYL BENZENE	<0.025	MG/KG				
TOTAL XYLENES	<0.025	MG/KG				
TOTAL BTEX	<0.10	MG/KG				
TPH (418.1)	<10	MG/KG			2.09	28
HEADSPACE PID	0	PPM				
PERCENT SOLIDS	93.7	%				

— TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 —

The Surrogate Recovery was at 95 % for this sample All QA/QC was acceptable.

Narrative:

ATI results attached.

DF = Dilution Factor Used

DF

7/17/94




Analytical **Technologies**, Inc.

2709-D Pan American Freeway NE Albuquerque, NM 87107
Phone (505) 344-3777 FAX (505) 344-4412

ATI I.D. 406351

June 21, 1994

El Paso Natural Gas Company
P.O. Box 4990
Farmington, NM 87499

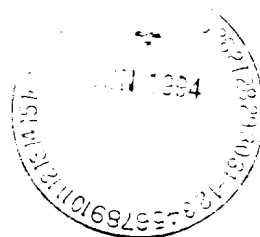

Project Name/Number: PIT CLOSURE 24324

Attention: John Lambdin

On 06/14/94, Analytical Technologies, Inc., (ADHS License No. AZ0015), received a request to analyze **non-aqueous** samples. The samples were analyzed with EPA methodology or equivalent methods. The results of these analyses and the quality control data, which follow each set of analyses, are enclosed.

If you have any questions or comments, please do not hesitate to contact us at (505) 344-3777.

Letitia Krakowski, Ph.D.
Project Manager

H. Mitchell Rubenstein, Ph.D.
Laboratory Manager

MR:jd

Enclosure



Analytical **Technologies**, Inc.

GAS CHROMATOGRAPHY RESULTS

TEST : BTEX (EPA 8020)
CLIENT : EL PASO NATURAL GAS CO. ATI I.D.: 406351
PROJECT # : 24324
PROJECT NAME : PIT CLOSURE

SAMPLE ID. #	CLIENT I.D.	MATRIX	DATE SAMPLED	DATE EXTRACTED	DATE ANALYZED	DIL. FACTOR
07	945380	NON-AQ	06/07/94	06/14/94	06/16/94	10
08	945381	NON-AQ	06/07/94	06/17/94	06/17/94	1
09	945382	NON-AQ	06/07/94	06/14/94	06/16/94	1

PARAMETER	UNITS	07	08	09
BENZENE	MG/KG	<0.25	<0.025	<0.025
TOLUENE	MG/KG	1.1	<0.025	0.055
ETHYLBENZENE	MG/KG	<0.25	<0.025	<0.025
TOTAL XYLENES	MG/KG	4.9	<0.025	0.032

SURROGATE:

BROMOFLUOROBENZENE (%) 109 95 92