

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE\*  
(Other instructions on reverse side)

Form approved.  
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER		5. LEASE DESIGNATION AND SERIAL NO. NM 17018
2. NAME OF OPERATOR Dugan Production Corp.		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR Box 234, Farmington, NM 87401		7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 990' FNL - 990' FWL		8. FARM OR LEASE NAME ABO
14. PERMIT NO.		9. WELL NO. 1
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6056' GR		10. FIELD AND POOL, OR WILDCAT Undesignated - PC
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 28, T26N, R12W
		12. COUNTY OR PARISH San Juan
		13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input checked="" type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) _____	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)


17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

10-10-75

Moved in Morrow Drilling Company rig and spudded 7-7/8" hole @ 2:00 PM 10-10-75. Drilled to 33' w/air and ran one jt 5-1/2" OD 14# 8R ST&C "B" condition csg. TE 33' set @ 33' GR. Cemented w/5 sx cement. POB 5:00 PM 10-10-75. WOC.

10-14-75

TD 1175'. Ran 38 jts 2-7/8" OD 6.5# 8R EUE J-55 csg set @ 1170' GR. Ran hydro test - OK. Hydro test tools would not pull thru pipe, had to test on ground. Cemented w/75 sx 2% Lo-Dense Class "B" cement with 1/4# Cello-Flake/sk. Good mud returns while cementing, worked pipe OK, bumped plug w/1500 psi - held OK. POB 3:45 PM 10-14-75, released pressure to 750#, job complete.

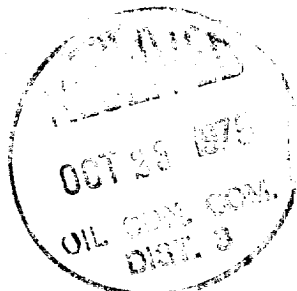

RECEIVED

OCT 22 1975

U. S. GEOLOGICAL SURVEY

18. I hereby certify that the foregoing is true and correct

SIGNED Thomas A. Dugan TITLE Engineer DATE 10-16-75

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY: