

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well <input checked="" type="checkbox"/> gas well <input type="checkbox"/> other <input type="checkbox"/>
2. NAME OF OPERATOR Mobil Oil Corporation
3. ADDRESS OF OPERATOR 9 Greenway Pl. Ste. 2700, Hou., TX 77046
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.) AT SURFACE: 1980' FEL & 660 FNL AT TOP PROD. INTERVAL: AT TOTAL DEPTH: same as surface
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:	SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF <input type="checkbox"/>	<input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	<input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	<input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	<input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	<input type="checkbox"/>
MULTIPLE COMPLETE <input type="checkbox"/>	<input type="checkbox"/>
CHANGE ZONES <input type="checkbox"/>	<input type="checkbox"/>
PLUG BACK (other) rpt of DST & Plugging operations	<input type="checkbox"/>

5. LEASE 14-20-603-5019	
6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
7. UNIT AGREEMENT NAME	
8. FARM OR LEASE NAME Navajo	
9. WELL NO. 6	
10. FIELD OR WILDCAT NAME Tocito Dome-Penn D. Assoc.	
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 3, T26N, R18W	
12. COUNTY OR PARISH San Juan	13. STATE New Mexico
14. API NO.	
15. ELEVATIONS (SHOW DF, KDB, AND WD) 5624' GL	

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 6/2/79 - Ran GR & BBC Acoustic 6881-1600
- 6/3/79 - Cond mud for DST #1 6760-6881, SI in 2-1/2 hrs, initial FP 40-53, initial SIWHP 133, 2nd BHFP 53-67, 2nd BHSIF 214, rec. 451' drlg. mud w/no show.
- 6/4/79 - DST #2 6380-6460 by Howco, TP/35, SI in 1 1/2 hrs open on 1/4" ck., gas cut mud to surf in 10 min. rec brackish wtr. w/tr. oil, SI 2 hrs, POH rec DP full of brackish wtr. 0.116 Ohms resistivity, continue to test through 6/7/79.
- 6/8/79 - Howco spot 66 sxs Lt. Wt. @ 6500-6300 & 65 sxs. 5600-5400.
- 6/9/79 - Verbal permission to P & A Granted by USGS/Farmington.
- 6/9/79 - Howco set 130 sx Lt. Wt. 4000-3600, 80 sx 2200-2000, 110 sx B 1700-1500, 30 sx 0-50. rel rig 12:30 AM, Well P & A.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.



18. I hereby certify that the foregoing is true and correct

SIGNED Robbie Jay TITLE Authorized Geologist DATE 7/11/79

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

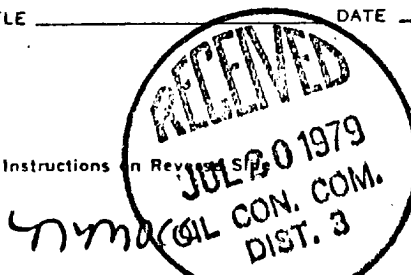

JUL 16 1979

U. S. GEOLOGICAL SURVEY
DURANGO, COLO.