AT TOTAL DEPTH:

REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO: TEST WATER SHUT-OFF

FRACTURE TREAT SHOOT OR ACIDIZE

PULL OR ALTER CASING MULTIPLE COMPLETE CHANGE ZONES ABANDON*

REPAIR WELL

(other)

AT TOP PROD. INTERVAL: same

X

 \mathbf{x}

spud thru completion

UNITED STATES DEPARTMENT OF THE INTERIOR **GEOLOGICAL SURVEY**

same

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE,

UNITED STATES DEPARTMENT OF THE INTERIOR	5. LEASE SF 080238-A		
GEOLOGICAL SURVEY	6. IF INDIAN, ALLOTTE	E OR TRIBE NAME	
SUNDRY NOTICES AND REPORTS ON WELLS (Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.) 1. oil gas well other	7. UNIT AGREEMENT PAME		
	8. FARM OR LEASE NAME Chaco Ltd.		
	9. WELL NO. 3 10. FIELD OR WILDCAT NAME		
2. NAME OF OPERATOR J. Gregory Merrion & Robert L. Bayless			
3. ADDRESS OF OPERATOR P.O. Box 1541, Farmington, NM 87401	WAW Fr./Pic. Cliffs 11. SEC., T., R., M., OR 3LK. AND SURVEY O		
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)	AREA Sec. 12, T26N, R13W		
AT SURFACE: 1800 FNL & 1850 FWL AT TOP PROD. INTERVAL: same	12. COUNTY OR PARISH San Juan	13. STATE N.M.	

15. ELEVATIONS (SHOW DF, KDB, AND WD)

(NOTE: Report results of multiple completion or zone

change on Form 9-330.)


14. ARI NO.

6023' GL

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

SUBSEQUENT REPORT OF:

See attached daily summary.

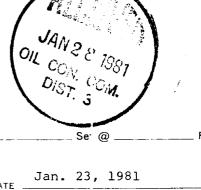

Subsurface Safety Valve: Manu. a	nd Type		Se [.] @	Ft.
18. I hereby certify that the foreg	oing is true and correct			
SIGNED	oing is true and correct Operator	Ja DATE	an. 23, 1981	
1-	(This space for Federal or State of	fice use)		
APPROVED BYCONDITIONS OF APPROVAL. IF ANY	TITLE	DATE		
೯೯೪ ನಲ್ಲಿ ೯೮೮ ಕಲ್ಪಟ್ಟಿಗಳು	Ì.			

*See Instructions on Reverse Side

FARMINGTON DISTRICT

JAN 27 1551

F7 /

DAILY REPORT

Chaco Ltd. #3 Section 12, T26N, R13W San Juan County, New Mexico

- 01-05-81 Spud, set 7" surface casing @ 93.2 ft. w/35 sacks Class B w/2% CACL2. Circulated back to surface.
- 01-06-81 Drilling @ 400' w/4-3/4" hole.
- 01-07-81 Drilling @ 820'.
- 01-08-81 Drilling @ 1150'.
- 01-09-81 TD @ 1300'. Condition mud.
- 01-10-81 Ran 32 jts. of 2-7/8" to 1284'. PBTD 1254' w/85 sacks 50-50 pozmix, 35 sacks neat 2% CACL₂. Circulated to surface. WOCT
- O1-17-81 Ran Gamma-Ray Correlation log. Perforated Pictured Cliffs @ 1194-97 ft. and 1204-10 ft. w/2PF, 2-1/8" glass jets. (SSD)
- 01-18-81 Western Co. fraced w/15,000 # 10/20 sand and 70 quality foam. Flowing back. (SSD)
- 01-20-81 IPF 42 MCF/day w/medium spray water after 48 hrs. SII: 208 PSIG. Shut in gas well. (SSD)