

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 079582
Unit San Juan 28-5 Unit
14-08-001-249

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	<u>Water Frac.</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

December 13, 1960


Well No. 47-35 is located 930 ft. from N line and 1850 ft. from E line of sec. 36
NE Sec. 36 28-N 5-W N.M.P.M.
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco Mesa Verde Rio Arriba New Mexico
 (Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6746 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

11-19-60 Total Depth 6015'. C.O.T.D. 5969'.
 Water frac Point Lookout perf int 5792-98; 5804-10; 5820-30;
 5852-3; 5880-38; 5898-5906; 5936-5946; w/70,686 gal water,
 & 60,000 # sand. BDP 1100 #, max pr 2400 #, avg tr pr 1100-1200-
 1300-1450-1700-2400 #. IN 65 BPM. Flush 10,000 gal.
 Dropped 5 sets of 20 balls-6 stages.

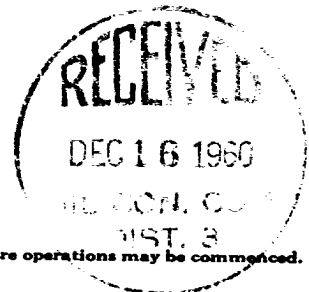

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company
 Address Box 990,
Farmington, New Mexico

ORIGINAL SIGNED W.E. MCANALLY
 By

Title Petroleum Engineer