

(SUBMIT IN TRIPLICATE)


Indian Agency _____

Jicarilla Apache

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee _____

Lease No. **Contract #21
Boulder Lease**

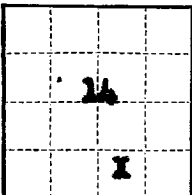

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL _____	SUBSEQUENT REPORT OF WATER SHUT-OFF _____	RECEIVED JUN 21 1962 U. S. GEOLOGICAL SURVEY WASHINGTON, NEW MEXICO
NOTICE OF INTENTION TO CHANGE PLANS _____	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING _____	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF _____	SUBSEQUENT REPORT OF ALTERING CASING _____	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL _____	SUBSEQUENT REPORT OF REDRILLING OR REPAIR _____	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE _____	SUBSEQUENT REPORT OF ABANDONMENT _____	
NOTICE OF INTENTION TO PULL OR ALTER CASING _____	SUPPLEMENTARY WELL HISTORY _____	
NOTICE OF INTENTION TO ABANDON WELL _____		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 19, 1962


Boulder
Well No. **34-14** is located **730** ft. from **S** line and **2260** ft. from **E** line of sec. **14**
Sec. 14 **28N** **1W** **N.M.P.M.**
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Boulder Mancos **Rio Arriba** **New Mexico**
 (Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is **7329** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

- 6/23/62 3774 T.D. no shows, blow hole clean - ran E. log 3774/2800.
- 6/24/62 "vert'd in 6 1/2" open hole 2/16 crack jets at intervals 3747 to 3743. Ran (32 lbs) 1 1/2" - 9 1/2' J-55 cog. 10 1/4' incl. 310' - 1/8" x 3" slots at intervals. Last in open hole per collar/3306. Burns neoprene seal liner hanger. Top hanger 2730.
- 6/25/62 Oil frac. 3774/3341 with 1272 Hbls lease crude. Broke down 1800 psi. Ave. rate 55.3 Hbls/min. Ran tubing, rods & pump & put on production.

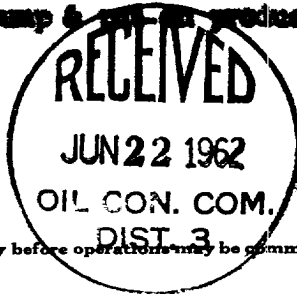

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **Secony Mobil Oil Company**

Address **P. O. Box 3371**

Durango, Colorado

By **PH Barry by JCM**
P. H. Barry
Dist. Prod. Supt.

Title _____

305 5 Page 1 File 1