


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office San Carlos Apache
Indian Reservation
Lease No. _____
Unit Contract No. 54
South Dulce

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF REDRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	OTHER USES OF WELL.....

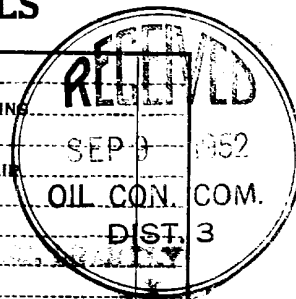

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 14, 1952, 19__

Well No. 1 is located 330 ft. from S line and 330 ft. from E line of sec. 8
Center 116 116 116 116
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
116 116 116 116
(Field) (County or Subdivision) (State or Territory)

The elevation of the ground above sea level is 7000 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

This well drilled to a total depth of 13,848 ft. No oil or gas encountered. Well abandoned temporarily as a failure; All pipe left in hole, 328 ft. of fish left in hole. Cemented 110' on top of plug 12,000 to 11,800' 5/8" 40 sacks 110' 5/8" cement. No. 2 plug 11,800' 5/8" cement in 9 5/8" casing 8000 to 8300'. No. 3 plug 11,800' 5/8" cement, 20 sacks 20' through perforation and 40 sacks in 9 5/8" casing 6035' to 6935'. Filled hole 6935' to 13,848' 5/8" x 3" Sledge 5/8" Valve & Bull Plug in top of 9 5/8" casing. Location cleaned & leveled, cellar filled & pit fenced & barbed & woven wire.

62-073
62-073-101(1)-102(2)-file

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Continental Oil Company

Address Shiprock, New Mexico

By W. L. Purson

Title Area Foreman

