


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Santa Fe
Land Office
Lease No. 079250
Unit San Juan 28-5 Unit

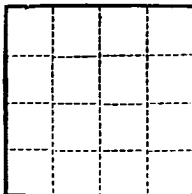

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	Water Frac.	X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 2, 1963

Well No. 61 is located 1650 ft. from ~~XX~~^[N] line and 990 ft. from ~~XX~~^[E] line of sec. 18


NE Section 18 28-N 5-W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Basin Dakota Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6677 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

On 12-11-62 T.D. 8026'. C.O.T.D. 8008'.
Perf 7982-88; 7962-68; 7932-38 (2 SFF); 7884-96' (1 SFF);
7800-06 (2 SFF);
Frac w/80,000 gallons water, 70,000# sand. Flush
w/4900 gallons water. IR 38 BPM. Max pr 4200#, BDP
1600#, tr pr 3300-4000#. 4 drops of 12 bag 100

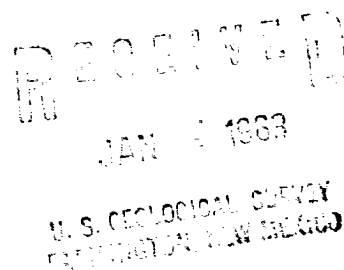

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company
Address Box 990
Farmington, New Mexico
By ORIGINAL SIGNED H.E. McANALLY
Title Petroleum Engineer