

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 019127
Unit San Juan 25-4 Unit
14-08-001-933

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

November 10, 1959

Well No. 21-7 is located 615 ft. from S line and 1475 ft. from W line of sec. 7
SW/4 Sec. 7 (1/4 Sec. and Sec. No.) 26N (Twp.) 4W (Range) M.A.P.M. (Meridian)
Blanco M. V. (Field) Rio Arriba (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 7390 ft.


DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 11-8-59 Total Depth 4,433'.
Ran 111 joints 7 5/8", J-55, 26.40%, casing (4529') set at 4541' with 40 sacks regular cement, 40 sacks Pozmix, 1/4 cu. ft. Strata-Crete 6"/sk & 2 1/2 Gal, followed with 50 sacks Neat cement.

Held 1000#/30 minutes.

Top of cement by temperature survey at 4300'.

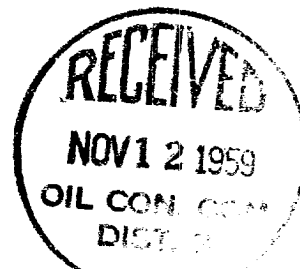

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico,

By ORIGINAL SIGNED J.J. TILLERSON

Title Petroleum Engineer