

BTEX
SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE

(Revised 3/9/94)

RANKING SCORE (TOTAL POINTS): 1

Date Remediation Started: 9-7-99 Date Completed: 9-9-99

Remediation Method: Excavation _____ Approx. cubic yards _____
(Check all appropriate sections) Landfarmed _____ Insitu Bioremediation _____
Other _____

Remediation Location: Onsite _____ Offsite _____
(ie. landfarmed onsite,
name and location of
offsite facility)

General Description Of Remedial Action: SAMPLE TAKEN - HIT BED ROCK 2' IN OFF
OF BOTTOM. TILL BOTTOM OF PIT 1', BACK FILL CLEAN SOIL.

Ground Water Encountered: No ☒ Yes _____ Depth _____

Final Pit: Sample location CENTER OF PIT
Closure Sampling:
(if multiple samples,
attach sample results
and diagram of sample
locations and depths) Sample depth 6
Sample date 9-3-99 Sample time 1433

Sample Results

Benzene (ppm) 115

Total BTEX (ppm) 63.480

Field headspace (ppm) 338

TPH 387

Ground Water Sample: Yes _____ No ☒ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST
OF MY KNOWLEDGE AND BELIEF

DATE 12-1-99

SIGNATURE

J. Valdez

PRINTED NAME
AND TITLE

Judson Valdez P.L.

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

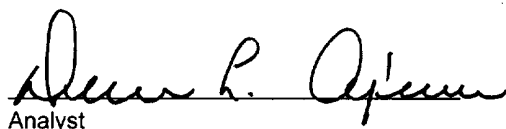
Client:	Conoco	Project #:	707003-093
Sample ID:	BDP - Grab	Date Reported:	09-08-99
Laboratory Number:	G049	Date Sampled:	09-03-99
Chain of Custody No:	7124	Date Received:	09-07-99
Sample Matrix:	Soil	Date Extracted:	09-08-99
Preservative:	Cool	Date Analyzed:	09-08-99
Condition:	Cool and Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	316	0.2
Diesel Range (C10 - C28)	71.4	0.1
Total Petroleum Hydrocarbons	387	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: San Juan 28 - 7 # 178. OVM Reading 338. Hit Bed Rock 2' In.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Conoco	Project #:	707003-093
Sample ID:	BDP - Grab	Date Reported:	09-08-99
Laboratory Number:	G049	Date Sampled:	09-03-99
Chain of Custody:	7124	Date Received:	09-07-99
Sample Matrix:	Soil	Date Analyzed:	09-08-99
Preservative:	Cool	Date Extracted:	09-08-99
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	115	8.8
Toluene	2,500	8.4
Ethylbenzene	5,390	7.6
p,m-Xylene	40,420	10.8
o-Xylene	15,060	5.2
Total BTEX	63,480	


ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Trifluorotoluene	100 %
	Bromofluorobenzene	100 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: San Juan 28 - 7 # 178. OVM Reading 338. Hit Bed Rock 2' In.


Analyst


Review

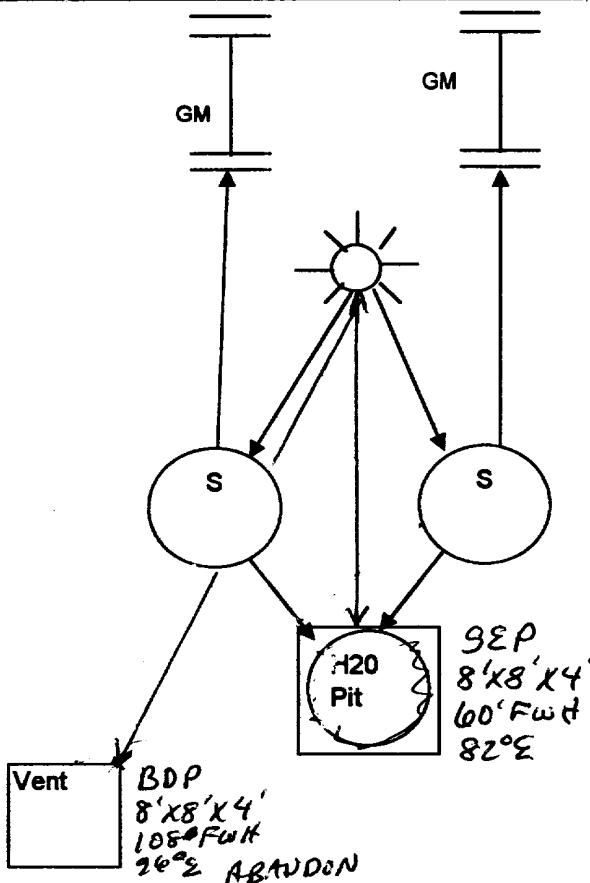
7124

ENVIROTECH INC.

5796 U.S. Highway 64
Farmington, New Mexico 87401
(505) 632-0615

Lease Name: San Juan 28-7 #1, 8 Operator: SM Date: ~~8-3-99~~ 9-3-99

Site Security
(Indicate North)



Lease Name: San Juan 28-7 #178
Federal/ Indian Lease No: SF 078500A
CA No.: NA
Unit : P
Legal Description: Sect: 31 TP: 28N R: 7W
County: Rio Arriba, NM

Load line valves :
Sealed during Production

Drain line valves :
Sealed during Production

Production Line valve:
Sealed during sales

This lease is subject to the site security plan for
San Juan Basin Operations. The plan is located at:
Conoco Inc.
3315 Bloomfield Hwy
Farmington, NM