

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐
well well
2. NAME OF OPERATOR
Northwest Pipeline Corporation
3. ADDRESS OF OPERATOR
P.O. Box 90, Farmington, N.M. 87401
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1100' FSL & 850' FWL
AT TOP PROD. INTERVAL: Same as above
AT TOTAL DEPTH: Same as above
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:


- TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) Drlg Operations

SUBSEQUENT REPORT OF:

- ☐
☐
☐
☐
☐
☐
☐
☐
☒

5. LEASE
SF 079727-A
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
Valencia Canyon
9. WELL NO.
#1
10. FIELD OR WILDCAT NAME
Undesignated Pictured Cliffs E. pt
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec 10 T28N R4W
12. COUNTY OR PARISH
Rio Arriba
13. STATE
New Mexico
14. API NO.
30-039-22502
15. ELEVATIONS (SHOW DF, KDB, AND WD)
7370' GR

(NOTE: Report results of multiple completion or zone change on Form 9-331-C)

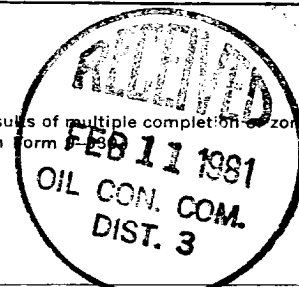

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1-21-81 to 1-31-81 Drlg ahead to a depth of 4720' (TD)

2-1-81 Ran IES/FDC/CNL/GR Logs. Ran 153 jts (4706') of 2-7/8", 6.4#, J-55, Butress
2-2-81 set at 4718'. Cemented w/ 100 sx 65/35 poz w/ 12% gel, 12-1/2# fine
gilsonite/sx. Tailed w/ 100 sx Cl "B" w/ 6% gel, 12-1/2# gils/sx. Displaced
plug w/ 1 bbl acetic acid & 26 bbls wtr. Down at 0415 hrs 2-2-81. Tested
csg to 4000# when plug bumped. SI w/ 500#. Wilson ran temp survey and
found PBTD @ 4712' with top of cement at 3300'. (Ojo Alamo @ 3605'). Rig
released at 0615 hrs.

NOW WAITING ON COMPLETION.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Donna J. Brace TITLE Production Clerk DATE Feb 4, 1981

Donna J. Brace

(This space for Federal or State office use)

APPROVED BY _____
CONDITION OF APPROVAL, IF ANY:

TITLE _____ DATE _____

FARMINGTON DISTRICT

NMOCC

djb/