

Navajo Tribal 701
(SUBMIT IN TRIPLICATE)


Budget Bureau No. 42-R-359.3
Approval expires 12-31-55.

Indian Agency Navajo

**UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY**

Allottee _____

Lease No. 14-52-403-2190

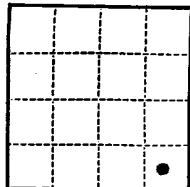

Sec. 31

SUNDRY NOTICES AND REPORTS ON WELLS

| | |
|---|--|
| NOTICE OF INTENTION TO DRILL | SUBSEQUENT REPORT OF WATER SHUT-OFF |
| NOTICE OF INTENTION TO CHANGE PLANS | SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING |
| NOTICE OF INTENTION TO TEST WATER SHUT-OFF | SUBSEQUENT REPORT OF ALTERING CASING |
| NOTICE OF INTENTION TO REDRILL OR REPAIR WELL | SUBSEQUENT REPORT OF REDRILLING OR REPAIR |
| NOTICE OF INTENTION TO SHOOT OR ACIDIZE | SUBSEQUENT REPORT OF ABANDONMENT |
| NOTICE OF INTENTION TO PULL OR ALTER CASING | SUPPLEMENTARY WELL HISTORY |
| NOTICE OF INTENTION TO ABANDON WELL | |

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

RECEIVED
JUN 5 1958

U. S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

Navajo Tribal 7
Well No. 1 is located 790 ft. from S line and 330 ft. from E line of sec. 31

SE 1/4, SE 1/4, Sec. 31 27 N 14 W NMPN
(34 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Undesignated San Juan County New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5900 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

8 3/4" hole was drilled to a total depth of 4518' in the Gallup Zone. The interval 3515'-3555' was drill stem tested (Point Lockout) for 2 hrs. in which 300' of mud cut sulphur water and 2100' sulphur water was recovered. 1 hr. IBIP-1550 psi, IFF-100 psi, FFF-1200 psi & 1 hr. FBIP-1500 psi.

Also the Point Lockout was tested in the interval 3586'-3634' for 1 hr. which recovered 35' of drilling mud. IFF-50 psi, FFF-60psi, 30 min. FBIP- 1200 psi.

The interval 4715'-4818' was cored as follows: 22' sh., 9' VI gr. sd.-good odor & faint finer., 5' sh., 4' sh. bleeding oil & gas, 3' sd.-fair show, 9' sd.-good show, 8' sd.-slight show, 18' sd.-no show, 18' shaly sd.-fair show & 7' very shaly sd.-slight show.

The well was plugged and abandoned as reported on 6-3-58.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Standard Oil Company of Texas

Address Box 1581

Farmington, New Mexico

By Charles H. Lantry

Title Field Foreman

1944
OFFICE OF THE
COMMISSIONER
OF THE
REVENUE
DEPARTMENT
OF THE
STATE OF
NEW YORK