


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe, N.M.
Lease No. 89-078081
Unit Barfante Unit I
Sec. 943

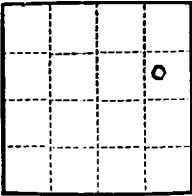

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....		SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....		SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....		SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....		SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		<u>Subsequent Report of Casing</u>	<u>X</u>
		<u>Setting</u>	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)


April 1, 1963

Well No. 1-33 is located 1530 ft. from N line and 1190 ft. from E line of sec. 33

NE/4 Sec. 33
(1/4 Sec. and Sec. No.)
Main-Dakota
(Field)

T7-N 9-W
(Twp.) (Range)
San Juan
(County or Subdivision)

18N
(Meridian)
New Mexico
(State or Territory)

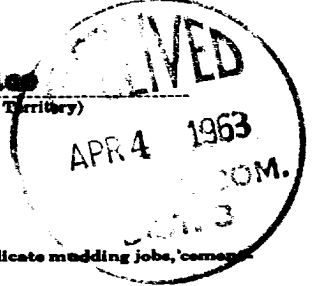

The elevation of the derrick floor above sea level is 6,669.5 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On November 30, 1962 ran and set 10 joints of 6-5/8", 32# N-40 SR thread casing @ 331.63'. Cemented with 250 sacks common cement and the cement was circulated to surface. On December 26, 1962 ran and set 219 joints of 5 1/2", 14.0# to 15.5# J-55, SR thread casing @ 7089.43'. Cemented with 250 sacks Incoer with 0.75% Haled 9 through float shoe. Cemented through stage collar @ 4,970.98' with 100 sacks Incoer with 12.5% Gilsomite per sack with 0.75% Haled 9. Cemented through stage collar @ 2557.8 with 300 sacks Formix 50-50 S with 6% gel with 12.5% Gilsomite per sack.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Austral Oil Company Incorporated

Address 300 San Jacinto Building
Houston 2, Texas

By [Signature]
H. Copeland
Title Drilling Superintendent