



EL PASO FIELD SERVICES

FIELD PIT SITE ASSESSMENT FORM

GENERAL

Meter: 74885 Location: Huerfano unit No. 59-23
 Operator #: 2999 Operator Name: Merran P/L District: Ballard
 Coordinates: Letter: E Section 23 Township: 27 Range: 9W
 Or Latitude _____ Longitude _____
 Pit Type: Dehydrator _____ Location Drip: ☒ Line Drip: _____ Other: _____
 Site Assessment Date: 6-15-94 Area: 11 Run: 71

SITE ASSESSMENT

NMOCD Zone:

(From NMOCD Maps)

Inside
Outside

Land Type: BLM ☒ (1)State ☐ (2)
☒ (1) Denny Fed. Forest (3)
☐ (2) DEPUTY OIL & GAS INSPECTOR

Depth to Groundwater

Less Than 50 Feet (20 points)

50 Ft to 99 Ft (10 points)

Greater Than 100 Ft (0 points)

☒ (1)☐ (2)☐ (3)

SEP 11 0 1996

Wellhead Protection Area :

Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction? , or ; Is it less than 200 ft from a private domestic water source? ☐ (1) YES (20 points) ☒ (2) NO (0 points)

Horizontal Distance to Surface Water Body

Less Than 200 Ft (20 points)

200 Ft to 1000 Ft (10 points)

Greater Than 1000 Ft (0 points)

☒ (1)☐ (2)☐ (3)Name of Surface Water Body Huerfano Canyon

(Surface Water Body : Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds)


Distance to Nearest Ephemeral Stream ☐ (1) < 100' (Navajo Pits Only)
☐ (2) > 100'

TOTAL HAZARD RANKING SCORE: 40 POINTSRemarks : One pit - dryInside V.Z. on Redline & TopoDigit HandPush to K6W 675-44

REMARKS

ORIGINAL PIT LOCATION

Original Pit : a) Degrees from North 342 Footage from Wellhead 102
 b) Length : 16 Width : 16 -Depth : 3

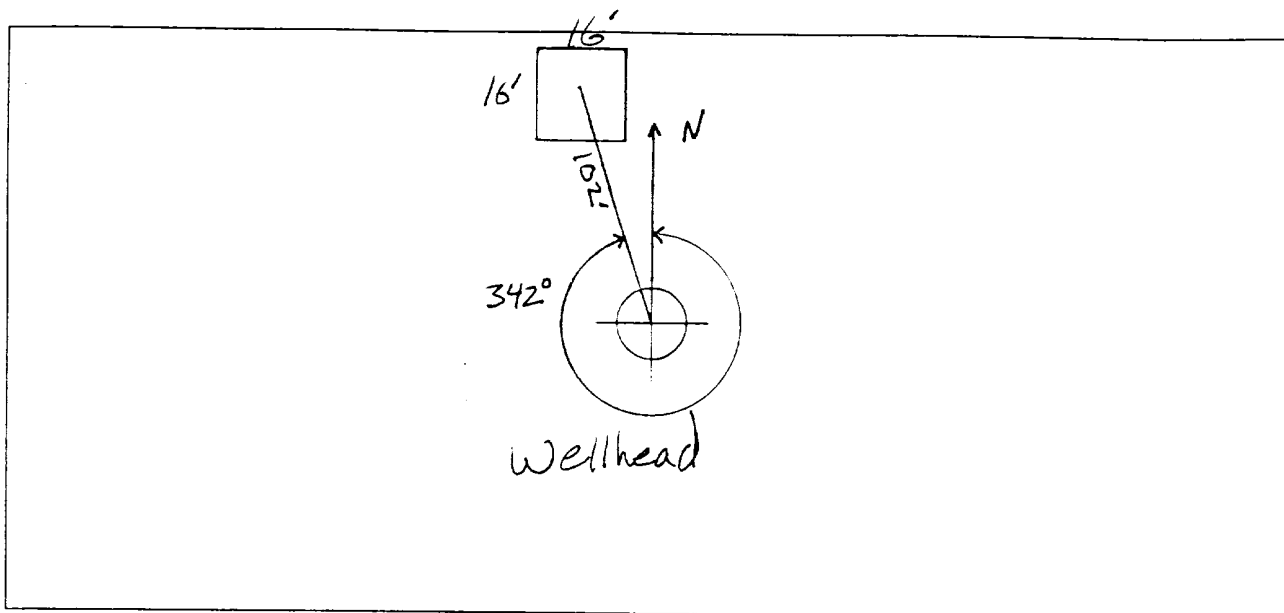

Remarks :

Photos - 1205 hrs

Bobtail

Completed By:

[Signature]

Signature

6-15-84

Date

FIELD PIT REMEDIATION/CLOSURE FORM

GENERAL	Meter: <u>74885</u> Location: <u>Huerfano unit # 59-23</u> Coordinates: Letter: <u>E</u> Section <u>23</u> Township: <u>27</u> Range: <u>9W</u> Or Latitude _____ Longitude _____ Date Started : <u>8/19/94</u> Run: <u>11</u> <u>71</u>
FIELD OBSERVATIONS	Sample Number(s): <u>KD 227</u> Sample Depth: <u>12'</u> Feet Final PID Reading <u>3 ppm</u> PID Reading Depth <u>12'</u> Feet Yes No Groundwater Encountered ☐ ☒ Approximate Depth _____ Feet
CLOSURE	Remediation Method : Excavation ☐ Approx. Cubic Yards <u>0</u> Onsite Bioremediation ☐ Backfill Pit Without Excavation ☒ Soil Disposition: Envirotech ☐ Tierra ☐ Other Facility ☐ Name: _____ Pit Closure Date: <u>8/19/94</u> Pit Closed By: <u>BEI</u>
REMARKS	Remarks : <u>Dug test Hole to 12', TOOK pid sample, closed pit.</u>
	Signature of Specialist: <u>[Signature]</u>



FIELD SERVICES LABORATORY

ANALYTICAL REPORT

PIT CLOSURE PROJECT - Soil Samples Inside the GWV Zone

SAMPLE IDENTIFICATION

	Field ID	Lab ID
SAMPLE NUMBER:	KD 227	945980
MTR CODE SITE NAME:	74885	N/A
SAMPLE DATE TIME (Hrs):	8-19-94	0845
SAMPLED BY:	N/A	
DATE OF TPH EXT. ANAL.:	8-24-94	8-24-94
DATE OF BTEX EXT. ANAL.:	8/25/94	8/26/94
TYPE DESCRIPTION:	VG	Brown coarse sand

REMARKS:

RESULTS

PARAMETER	RESULT	UNITS	QUALIFIERS			
			DF	Q	M(g)	V(ml)
BENZENE	LO.025	MG/KG	1			
TOLUENE	< 0.025	MG/KG	1			
ETHYL BENZENE	< 0.025	MG/KG	1			
TOTAL XYLENES	< 0.025	MG/KG	1			
TOTAL BTEX	< 0.10	MG/KG				
TPH (418.1)	100% 42.0	MG/KG			2.13	28
HEADSPACE PID	3	PPM				
PERCENT SOLIDS	92.9	%				

-- TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 --

The Surrogate Recovery was at 96 % for this sample All QA/QC was acceptable.

Narrative:

ATI results attached.

DF = Dilution Factor Used

Approved By:

AS

Date:

9/30/94



Analytical**Technologies**, Inc.

2709-D Pan American Freeway, NE Albuquerque, NM 87107
Phone (505) 344-3777 FAX (505) 344-4413

ATI I.D. 408397

August 29, 1994

El Paso Natural Gas Co.
P.O. Box 4990
Farmington, NM 87499

Project Name/Number: PIT CLOSURE 24324

Attention: John Lambdin

On 08/25/94, Analytical Technologies, Inc., (ADHS License No. AZ0015), received a request to analyze **non-aqueous** samples. The samples were analyzed with EPA methodology or equivalent methods. The results of these analyses and the quality control data, which follow each set of analyses, are enclosed.

If you have any questions or comments, please do not hesitate to contact us at (505) 344-3777.

H. Mitchell Rubenstein, Ph.D.
Laboratory Manager

MR:jtc

Enclosure





Analytical **Technologies**, Inc.

GAS CHROMATOGRAPHY RESULTS

TEST : BTEX (EPA 8020)
CLIENT : EL PASO NATURAL GAS CO. ATI I.D.: 408397
PROJECT # : 24324
PROJECT NAME : PIT CLOSURE

SAMPLE ID. #	CLIENT I.D.	MATRIX	DATE SAMPLED	DATE EXTRACTED	DATE ANALYZED	DIL. FACTOR
13	945979	NON-AQ	08/19/94	08/25/94	08/25/94	1
14	945980	NON-AQ	08/19/94	08/25/94	08/26/94	1
15	945981	NON-AQ	08/19/94	08/25/94	08/26/94	10
PARAMETER			UNITS	13	14	15
BENZENE			MG/KG	<0.025	<0.025	<0.25
TOLUENE			MG/KG	0.12	<0.025	<0.25
ETHYLBENZENE			MG/KG	<0.025	<0.025	<0.25
TOTAL XYLENES			MG/KG	0.040	<0.025	3.3

SURROGATE:

BROMOFLUOROBENZENE (%) 97 96 138*

*OUTSIDE ATI QUALITY CONTROL LIMITS DUE TO MATRIX INTERFERENCE