

(SUBMIT IN TRIPLICATE)

Indian Agency **Window Rock**

	X	

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee **Navajo Tribal**
Lease No. **I-149-Ind. 8182B**


SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO ABANDON WELL	SUBSEQUENT REPORT OF ABANDONMENT	
	SUPPLEMENTARY WELL HISTORY	
	Subsequent Report of Sandfrac Treatment	X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

December 8th, 19 **59**

Well No. **1-X** is located **1650** ft. from **N** line and **1650** ft. from **E** line of sec. **12**
SE 4 3/4 Sec. 12 **27N** **13W** **N.M.P.M.**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Undesignated **San Juan** **New Mexico**
(Field) (County or Subdivision) (State or Territory)

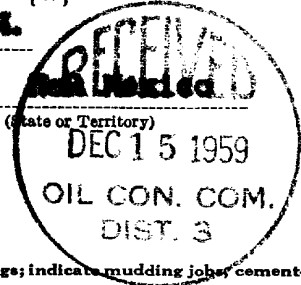

The elevation of the derrick floor above sea level is **5826** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

10-25-59 Sandfraced through perforations 5878-92', 5936-54; 5962-73', with 142,900 gallons water and 115,000# 20/40 sand. Average treating pressure for first 70,000# gallons 3700#. Well started to sand off. Pressure increased to 4800#. Discontinued sand. Flashed casing. Pressure broke back to 4000#. Restarted sand. Average treating pressure 3900#. Dropped 50 rubber balls. Treating pressure increased to average 4300#. Average injection rate 58.3 barrels per minute.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **BENSON-MONTIN-GREEN DRILLING CORP.**

Address **158 Petroleum Center Building**

Farmington, New Mexico

By *[Signature]*

Title **Vice-President**

