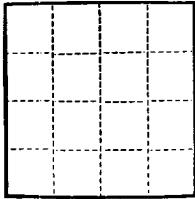


(SUBMIT IN TRIPLICATE)

Land Office **New Mexico**
Lease No. **01772-A**
Unit **Reid**UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 25, 19 58

Well No. 1-4 is located 1030 ft. from XXXX line and 921 ft. from XXXX line of sec. 8
SW Sec. 8 28N 9W N.M.P.M.
(¼ Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco M.V. San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6018 ft.


DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 6-21-58. Total Depth 2457'.
Ran 75 joints 7 5/8", J-55, 26.40#, casing (2446') set at 2456' with 75 sacks
regular cement, 75 sacks Pozmix, 37# Floccle and 25 gal, followed with 30
sacks Neat cement.

Held 1000# for 30 minutes.

Top of cement by temperature survey at 1310'.

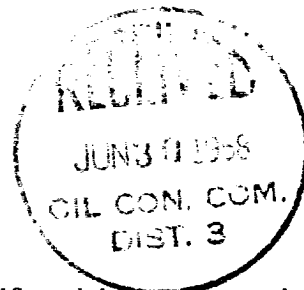

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas CompanyAddress Box 997Farmington, New MexicoBy Original Signed D. C. Johnston
Title Petroleum Engineer