

Form 9-331
(May 1966)UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 078566A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Lively

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Basin Dakota

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 27, T28N, R8W

12. COUNTY OR PARISH 13. STATE

San Juan

N.M.

1. OIL ☐ GAS ☒ OTHER ☐
WELL WELL

2. NAME OF OPERATOR

Lively Exploration Company

3. ADDRESS OF OPERATOR

Box 234, Farmington, New Mexico 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1800' FSL - 790' FEL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6146 GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETH ☐ABANDON* ☐CHANGE PLANS ☐


SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☒FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

11-8-72 Drig 13 3/4" @ 210' - bit #1 OSC 3 - 8 hrs water - spud @ 8:00 P.M.,
11-7-72 - 3 hrs wait on daylight - 10 hrs rig up - 3 hrs drill rat
and mouse hole - 8 hrs drill surface.

11-9-72 Drig @ 600' w/water - 1° slope @ 327' - bit #2 8 3/4" HTC X-3 -
1/2 hr cement surface - 12 hrs W.O.C. and nipple up - 2 hrs drig
8 3/4" hole - 1/2 hr repair cellar jet - 4 3/4" drig surface -
1 hr circulating - 1 3/4 hrs run surface csg - 1 1/2 hrs wait on
Dowell - ran 10 jts. 9 5/8" - T.E. 309.05' set @ 324' RKB - cemented
w/225 sks class A w/2% CaCl - cement circulated - P.O.B. 1:00 P.M.,
11-8-72.

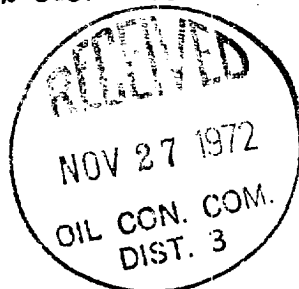

NOV 22 1972

U. S. GEOLOGICAL SURVEY

18. I hereby certify that the foregoing is true and correct

SIGNED

Original signed by

TITLE

Agent

DATE 11-20-72

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side