


(SUBMIT IN TRIPLICATE)

Indian Agency Navajo Tribal
Window Rock, Arizona
Allottee Jeanapah
Lease No. 11-20-603-762

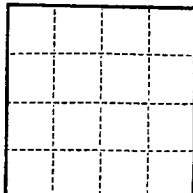

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	X
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Navajo Allotted Gas Unit "B" Farmington, New Mexico July 12, 19 57

Well No. 1 is located 1845 ft. from N line and 1180 ft. from E line of sec. 36

NE/4 of Section 36 T-28-N R-9-W E.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco-Mesaverde San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5827 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

This well was spudded on May 25, 1957, and on May 26, 1957, 10-3/4" casing was set at 230' with 170 sacks cement. After waiting on cement for 24 hours, casing and water shut-off were tested with 800 pounds for 30 minutes with no drop in pressure.

On May 30, 1957, 7-5/8" casing was landed at 2353' and cemented with 340 sacks cement. After waiting on cement for 24 hours casing and water shut-off were tested with 800 pounds pressure for 30 minutes with no drop in pressure.

On June 5, 1957, 5-1/2" casing was set at 4579' with 150 sacks cement. After waiting on cement for 24 hours, casing and water shut-off were tested with 800 pounds for 30 minutes with no drop in pressure. Completion operations were begun.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Pan American Petroleum Corporation

Address Box 487

Farmington, New Mexico

By [Signature]

Title Field Clerk

