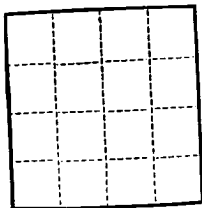


(SUBMIT IN TRIPLICATE)
**UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY**Land Office Santa Fe
Lease No. 077106
Unit Lackey**SUNDRY NOTICES AND REPORTS ON WELLS**

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	Water Fracture

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

February 1, 19 57

Well No. 9-B is located 915 ft. from N line and 790 ft. from W line of sec. 21
SW Section 21 28N 9W NM
($\frac{1}{4}$ Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Artec P.C. & Blanco San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6011 ft.**DETAILS OF WORK**

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

1-22-57 T.D. 4730'. Plug back T.D. 4696'. Water fractured Pictured Cliffs & Point Lookout perf. int. (P.C.) 2196-2210, 2220-2246 w/4 shots/ft. & (P.L.) 4538-4562, 4570-4580, 4586-4596, 4617-4624, 4632-4640, 4647-4656 w/2 shots/ft.) with 116,000 gals. water & 80,000 sand. Max. pr. 1350#, avg. tr. pr. 1000#. I.R. 66.7 BPM. Flush 5000 gals. Fraced in 3 stages w/175 perf. balls after 24,000 gal. & 100 perf. balls after 48,000 gallons.

1-25-57 T.D. 4730'. Water fraced Point Lookout perf. int. 4538-4562, 4570-4580, 4586-4596, 4617-4624, 4632-4640, 4647-4656 w/34,900 gals. water & 30,300 sand. Max. pr. 3500#, avg. tr. pr. 2800#. I.R. 9.2 BPM. Job sanded off.

1-29-57 T.D. 4730'. Water fraced Point Lookout perf. int. 4538-4562, 4570-4580, 4586-4596, 4617-4624, 4632-4640, 4647-4656 w/4 shots/ft. with 57,000 gals. water & 22,500 sand. Max. pr. 4000#, avg. tr. pr. 3800#. I.R. 11 BPM. Job sanded off.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas CompanyAddress Box 997
Farmington, New MexicoBy Original Signed EWELL N. WALSHTitle Petroleum Engineer