

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office San Jose  
Lease No. SP 080701  
Unit Coin

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	<u>XX</u>
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 23, 1961

Well No. 12-0 is located 770 ft. from [N] line and 770 ft. from [E] line of sec. 15

Rt. Section 15 T-10N R-10W N.M.P.M.  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)


Dona Delana San Juan New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5550 ft. C.L.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

**P.B.T.D. - 6625'**  
**Jerd-water treated with 25,000# sand, 2013 Hbls. water, flushed with 201 Hbls. water**  
**Breakdown pt. - 1500**  
**Maximum - 3000**  
**Avg. treating pt. - 2500**  
**5 min. shut-in pt. - 900**  
**I.R. - 45.6 gpm**  
**dropped 210 Rubber ball sealers**  
**Ran 201 jts., 6387' of 2 3/8" tubing, landed at 6387**  
**Shut in for gauge.**

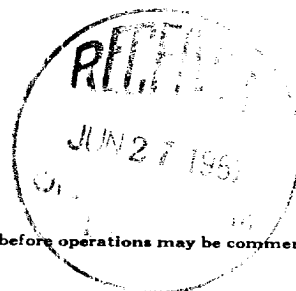

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Acres Oil and Gas Company

Address Dunker # 110  
Partridge, New Mexico

By Geo C. Nelson

Title District Superintendent