

OK

District I
P.O. Box 1980, Hobbs, NM
District II
P.O. Drawer DD, Artesia, NM 88211
District III
000 Rio Brazos Rd, Aztec, NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department
OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE

PIT REMEDIATION AND CLOSURE REPORT

Operator: CROSS TIMBERS OPERATING COMPANY Telephone: (505) 632-5200
Address: 6001 HIGHWAY 64, FARMINGTON, NM 87401
Facility or: J.C. DAVIDSON No. 2
Well Name _____
Location: Unit or Qtr/Qtr Sec E Sec 28 T 28 R 10 County SAN JUAN
Pit Type: Separator ☒ Dehydrator ☒ Other _____
Land Type: BLM ☒ State _____, Fee _____, Other _____

Pit Location: Pit dimensions: length 12, width 12, depth 4
(Attach diagram)
Reference: wellhead ☒, other _____
Footage from reference: 90'
Direction from reference: 75 Degrees ☒ East North ☒
of
_____ West South _____

Depth To Ground Water:
(Vertical distance from
contaminants to seasonal
high water elevation of
ground water)

Less than 50 feet (20 points)
50 feet to 99 feet (10 points)
Greater than 100 feet (0 Points) 0

Wellhead Protection Area:

(Less than 200 feet from a private
domestic water source, or; less than
1000 feet from all other water sources)

Yes (20 points)
No (0 points) 0

Distance To Surface Water:

(Horizontal distance to perennial
lakes, ponds, rivers, streams, creeks,
irrigation canals and ditches)

Less than 200 feet (20 points)
200 feet to 1000 feet (10 points)
Greater than 1000 feet (0 points) 0

RANKING SCORE (TOTAL POINTS): 0

Date Remediation Started: NA Date Completed: TESTED 7/8/00

Remediation Method: Excavation Approx. cubic yards 0
(Check all appropriate sections) Landfarmed Insitu Bioremediation

Other NA

Remediation Location: Onsite Offsite
(ie. landfarmed onsite, name and location of offsite facility)

General Description of Remedial Action: PIT TESTED BY HAND AUGERING

FIVE (5) BOREHOLES ON PERIMETER & CENTER OF PIT. FOUND

SHALESTONE @ 3' DEPTH.

Ground Water Encountered: No X Yes Depth

Final Pit:

Closure Sampling:

(if multiple samples, attach sample results and diagram of sample locations and depths)

Sample location see Attached Documents

Sample depth 3'

Sample date 7/8/00 Sample time 1130

Sample Results

Benzene(ppm) NA

Total BTEX(ppm) NA

Field headspace(ppm) 0.0

TPH 0.6

Ground Water Sample: Yes No X (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF

DATE 7/21/00

SIGNATURE Jeffrey C. Bagg

PRINTED NAME
AND TITLE

JEFFREY C. BAGG, NMPE 11607

TRAVEL NOTES: _____
 CALLOUT: _____ ONSITE: _____

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

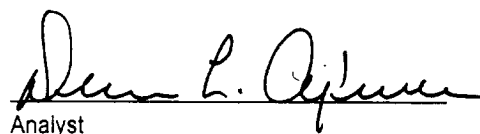
Client:	Blagg / Cross Timbers	Project #:	403410
Sample ID:	Sep/Dehy C @ 3'	Date Reported:	07-11-00
Laboratory Number:	H678	Date Sampled:	07-08-00
Chain of Custody No:	8054	Date Received:	07-10-00
Sample Matrix:	Soil	Date Extracted:	07-10-00
Preservative:	Cool	Date Analyzed:	07-11-00
Condition:	Cool and Intact	Analysis Requested:	8015 TPH


Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	0.6	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	0.6	0.1

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: J. C. Davidson #2.


Analyst


Review

08054

Client / Project Name		Project Location		ANALYSIS / PARAMETERS											
SAMPLER		Client No.		Remarks											
Sample No./ Identification	Sample Date	Sample Time	Lab Number	Sample Matrix	No. of Containers										
BLOW	7/8/00	0950	H677	Soil	1										
5 ft. Composite	"	1130	H678	"	1										
SEP/DEM															
C@3															
Relinquished by: (Signature)			Date		Time		Received by: (Signature)		Date		Time				
J.C. Blagg			7/8/00		1040		J.C. Davidson #2		7-16-00		1040				
Relinquished by: (Signature)							Received by: (Signature)								
Relinquished by: (Signature)							Received by: (Signature)								

ENVIROTECH INC.

5796 U.S. Highway 64
Farmington, New Mexico 87401
(505) 632-0615