

UNITED STATES
 DEPARTMENT OF THE INTERIOR
 GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well gas well other

2. NAME OF OPERATOR
 Jercme P. McHugh

3. ADDRESS OF OPERATOR
 Box 208, Farmington, NM 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
 1860' FNL - 990' FWL
 AT SURFACE:
 AT TOP PROD. INTERVAL:
 AT TOTAL DEPTH:

5. LEASE
 Contract 82

6. IF INDIAN, ALLOTTEE OR TRIBE NAME
 Jicarilla Apache

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
 Burke

9. WELL NO.
 1

10. FIELD OR WILDCAT NAME
 Choza Mesa PC

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
 Sec 31 T29N R3E S4W

12. COUNTY OR PARISH
 Rio Arriba


13. STATE
 NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)
 7005 GL 7017' RKB

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:	SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF <input type="checkbox"/>	<input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	<input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	<input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	<input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	<input type="checkbox"/>
MULTIPLE COMPLETE <input type="checkbox"/>	<input type="checkbox"/>
CHANGE ZONES <input type="checkbox"/>	<input type="checkbox"/>
ABANDON* <input type="checkbox"/>	<input checked="" type="checkbox"/>
(other) <input type="checkbox"/>	

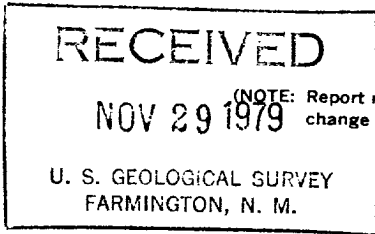


(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

This well was plugged and abandoned in the following manner:

1. Spotted 26 sx (30.68 cu ft) plug from 4002-3660' thru 2" tbg.
2. Spotted 5 sx (5.9 cu ft) from 225' to 160' thru 2" tbg
3. Attempted to pump down 8-5/8" x 4-1/2" annulus, could not break down with 1500 psi.
4. Installed dry hole marker w/6 sx cement. Cement work complete 10-
5. Filled pits and cleaned location.

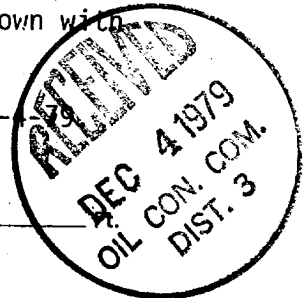

Subsurface Safety Valve: Manu. and Type _____ Set @ _____

18. I hereby certify that the foregoing is true and correct

SIGNED Jim L. Jacobs TITLE Agent DATE 11-27-79

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE NOV 30 1979

CONDITIONS OF APPROVAL, IF ANY:

U. S. GEOLOGICAL SURVEY
 DURANGO, COLO.