


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Indian Agency
Allottee
Lease No.

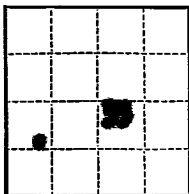

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)


Well No. is located ft. from line and ft. from line of sec.
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
 (Field) (County or Subdivision) (State or Territory)

The elevation of the above sea level is ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spudded well 8-8-63. Drilled 20-1/2" hole to 230'.
Set 8-5/8" O.D., 24.00 lb./ft., 2-45 casing at 228.30'.
Cemented with 500 grade cement. Good return.
Mud on cement 20 hrs.
Pressure tested 8-1/2" O.D. casing and blow out preventers for 30 minutes. Initial pressure 2000 psi. Final pressure 700 psi. Pressure bleed off 60 psi 30 minutes.
Drilled out 8-9-63.

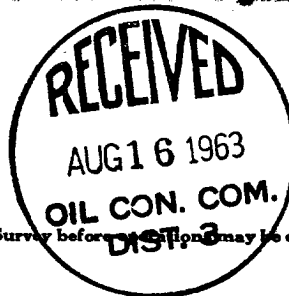

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Compton Oil & Refining Co.

Address P. O. Box 498

Stiney, Nebraska

By J. F. Rankin
Title Electrician Engineer