

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 079760
Unit San Juan 29-4
14-00-001-1095

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 28, 1958

Well No. 15-25 is located 1650 ft. from [N] line and 1650 ft. from [E] line of sec. 25

NE Sec. 25 20N 4W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Chaco Mesa P. C. Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)


The elevation of the derrick floor above sea level is 7003 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

This well was plugged and the casing salvaged in the following manner:

1. Pictured Cliffs perforations (3678-3944) squeezed w/50 sks. regular cement.
2. 1307' to 5 1/2', 15.50%, J-55 casing recovered.
3. Cement plug from 950' to 1350'.
4. Surface plugged w/10 sks. cement.
5. Marked with 4' x 4' post.

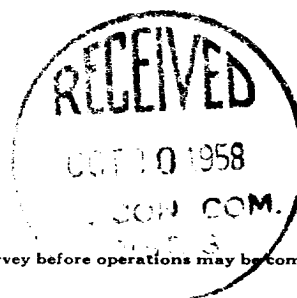

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 577

Farmington, New Mexico

By Original Signed D. W. Meehan

Title Petroleum Engineer